



SV660N Series Servo Drive **Troubleshooting Guide**



















Industrial Automation Intelligent Elevator

Preface

Introduction

Thank you for purchasing the SV660N series servo drive developed by Inovance. The SV660N series high-performance AC servo drive covers a power range from 50 W to 7.5 kW. It supports EtherCAT communication protocol and carries Ethernet communication interfaces to work with the host controller to implement networked operation of multiple servo drives.

The SV660N series servo drive supports stiffness level setting, inertia auto-tuning and vibration suppression to simplify the operation process. It allows a quiet and stable operation together with an MS1 series servo motor with low or medium inertia and a 23-bit single-turn or multi-turn absolute encoder.

The SV660N series servo drive aims to implement fast and accurate control in automation equipment such as semi-conductor manufacturing equipment, chip mounters, PCB punching machines, transport machineries, food processing machineries, machine tools, and transmission machineries.

This guide Introduces faults and fault levels, the troubleshooting process, warning codes and fault codes.

Name	Data Code	Description
SV660N Series Servo Drive Hardware Guide	19011432	This guide describes the installation and wiring of the drive, including pre- installation preparations, unpacking and transportation,mechanical installation, and electrical installation.
SV660N Series Servo Drive Selection Guide	19011431	Presents technical data and dimensions of the servo drive, and specifications and models of optional parts (installation accessories, cables, and periphery electrical parts).
SV660N Series Servo Drive Commissioning Guide	19011433	Presents servo commissioning, parameter descriptions, including the operating panel, commissioning software, commissioning procedure and a parameter list.
SV660N Series Servo Drive Function Guide	19011434	Presents functions and parameters, including function overview, basic servo functions, adjustment and parameter list.
SV660N Series Servo Drive Communication Guide	19011435	Presents functions and parameters of the servo drive, including EtherCAT communication configuration, parameter description, and communication application cases.

More documents

Name	Data Code	Description
SV660N Series Servo Drive Troubleshooting Guide	19011908	Introduces faults and fault levels, the troubleshooting process, warning codes and fault codes.
SV660N Series Servo Drive Safety Guide	19011883	Presents the safety function and related certifications and standards, wiring, commissioning process, troubleshooting, and functions.
SV660N Series Servo Drive Manual Package	PS00005512	Provides information on selection, installation, commissioning, function, troubleshooting and parameters of the equipment.

Revision History

Date	Version	Description
2023-07	B01	Added information on E122.2, E136.2, E140.3, E208.3, E663.0 and EE08.2.
2023-04	B00	Added warning E902.3.
2023-02	A02	 Modified description of H0b.34 (hexadecimal). Added error E664.0.
2023-01	A01	 Added warranty information in the preface. Added error codes and auxiliary codes to Warning Codes List and Error Codes List. Modified the description of fault logging. Updated information on faults.
2022-08	A00	First release

Access to the Guide

This guide is not delivered with the product. You can obtain the PDF version in the following way:

- Visit <u>http://www.inovance.com</u>, go to Support > Download, search by keyword, and then download the PDF file.
- Scan the QR code on the equipment to acquire more.

Warranty

Inovance provides warranty service within the warranty period (as specified in your order) for any fault or damage that is not caused by improper operation of the user. You will be charged for any repair work after the warranty period expires.

Within the warranty period, maintenance fee will be charged for the following damage:

- Damage caused by operations not following the instructions in the user guide
- Damage caused by fire, flood, or abnormal voltage

- Damage caused by unintended use of the product
- Damage caused by use beyond the specified scope of application of the product
- Damage or secondary damage caused by force majeure (natural disaster, earthquake, and lightning strike)

The maintenance fee is charged according to the latest Price List of Inovance. If otherwise agreed upon, the terms and conditions in the agreement shall prevail. For details, see the Product Warranty Card.

Table of Contents

Preface	1
Safety Precautions	5
1 Fault Level and Display	12
2 Fault Reset	14
3 Description of Warning Codes	16
4 Description of Fault Codes	31
4.1 Internal Faults	87
5 List of Warning Codes	89
6 List of Fault Codes	91

Safety Precautions

Safety Disclaimer

- Before installing, using, and maintaining this equipment, read the safety information and precautions thoroughly, and comply with them during operations, and comply with them during operations. To ensure the safety of humans and equipment, follow the signs on the equipment and all the safety instructions in this user guide. Failure to comply may result in severe personal injuries or even death or equipment damage.
- "CAUTION", "WARNING", and "DANGER" items in the user guide do not indicate all safety precautions that need to be followed; instead, they just supplement the safety precautions.
- Use this equipment according to the designated environment requirements. Damage caused by improper usage is not covered by warranty.
- Inovance shall take no responsibility for any personal injuries or property damage caused by improper usage.

Safety Levels and Definitions



Indicates that failure to comply with the notice will result in severe personal injuries or even death.

Indicates that failure to comply with the notice may result in death or severe personal injuries.




Indicates that failure to comply with the notice may result in minor or moderate personal injuries or equipment damage.

Safety Instructions


- Product illustrations in the user guide are sometimes shown without covers or protective guards. Remember to install the covers or protective guards as specified first, and then perform operations in accordance with the user guide.
- Product illustrations in this guide are for reference only. Actual products may vary.

Unpacking WARNING • Do not install the equipment if you find damage, rust, or indications of use on the equipment or accessories. • Do not install the equipment if you find water seepage, component missing or damage upon unpacking. • Do not install the equipment if you find the packing list does not conform to the equipment you received. CAUTION • Check whether the packing is intact and whether there is any sign of damage, water seepage, dampness, and deformation. • Unpack the package by following the unpacking sequence. Do not strike the package violently. Check whether there is any sign of damage or rust on the surfaces of the equipment and accessories. Check whether the package contents are consistent with the packing list. Storage and Transportation WARNING Allow only qualified professional personnel to carry large-scale or heavy products by using professional loading and unloading device. Failure to comply will result in injuries or product damage. Before you vertically lift the product, confirm that structural components of the product such as the front cover and terminal block have been firmly fixed with screws. Failure to comply will result in component drop-off, causing personnel injuries or product damage. • Never stand or stay below the product when it is lifted by hoisting device.


• When you hoist the product with a steel rope, hoist it at even speed stably to protect the product against vibration or impact. Do not turn the product or hoist the product for a long period. Failure to comply may result in personal injuries or damage to the device.

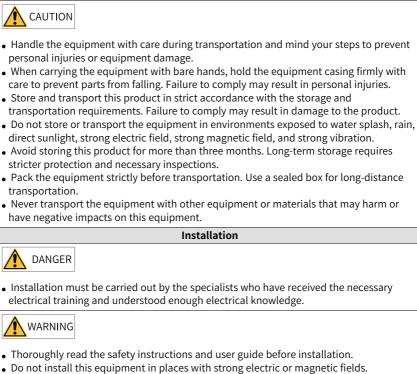


- Before installation, ensure that the installation position has sufficient mechanical strength to support the weight of the device. Failure to comply will result in a mechanical danger.
- To avoid electric shock, do not wear loose clothes or accessories.
- When this equipment is installed in a cabinet or final equipment, use a cooling device (such as a fan or air conditioner) to cool the environment down to the required temperature. Failure to comply may result in equipment over-temperature or a fire.
- Do not retrofit this equipment.
- Do not fiddle with the bolts used to fix equipment components or the bolts marked in red.
- When this product is installed in a cabinet or terminal device, protection measures such as a fireproof enclosure, an electrical enclosure, or a mechanical enclosure must be provided. The IP rating must meet IEC standards and local laws and regulations.
- Before installing devices with strong electromagnetic interference, such as a transformer, install a shielding device for the equipment to prevent malfunction.
- Install the equipment onto flame retardant materials, such as metal. Keep the equipment away from combustible objects. Failure to comply will result in a fire.

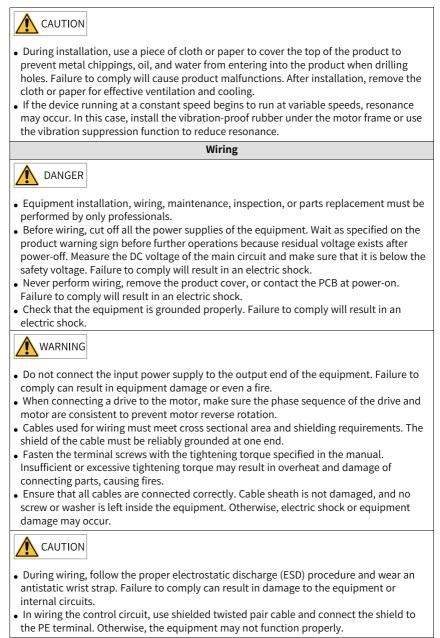

Power-on

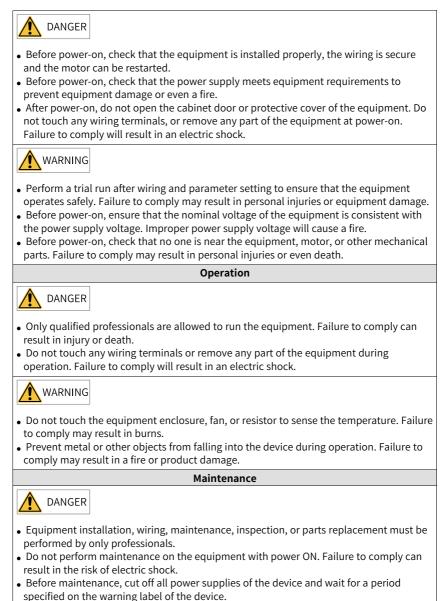

 When a PM motor rotates, its terminals will produce induced voltage even if the motor is powered off. Failure to comply will result in an electric shock.

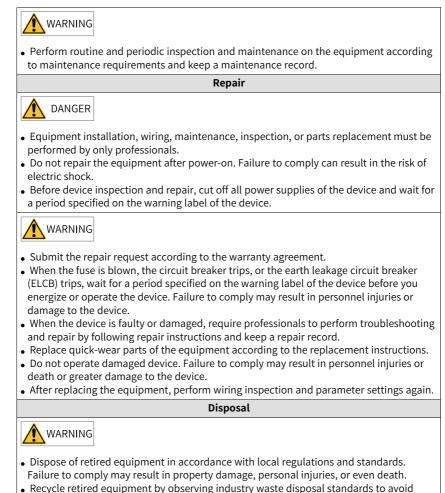

environmental pollution.

Other cautions

Dynamic brake

- Dynamic braking can only be used for emergency stop in case of failure and sudden power failure. Do not trigger failure or power failure frequently.
- Ensure that the dynamic braking function has an operation interval of more than 5 minutes at high speed, otherwise the internal dynamic braking circuit may be damaged.
- It is common in rotary mechanical structures. Under dynamic braking, after the motor power is cut off, it is still driven by the load on the shaft and is in a

regenerative state. A short circuit current passes through the brake and if the motor is driven continuously, the drive may burn, or even the motor may burn out.

Safety Signs

For safe equipment operation and maintenance, comply with safety signs on the equipment, and do not damage or remove the safety labels. The following table describes the safety signs.

Safety Sign	Description
たた を除 DANGER 高圧注意 Hazardous Voltage 満注意 High Temperature	 Never fail to connect the protective earth (PE) terminal. Read through the guide and follow the safety instructions before use. Do not touch terminals within 15 minutes after disconnecting the power supply to prevent the risk of electric shock. Do not touch the heatsink with power ON to prevent the risk of burn.

1 Fault Level and Display

Faults and warnings of the servo drive are divided into three levels based on severity: No. 1 > No. 2 > No. 3, as shown below.

- No. 1 non-resettable fault
- No. 1 resettable fault
- No. 2 resettable fault
- No. 3 resettable warning

Note

"Resettable" means the keypad stops displaying the fault/warning once a "Reset signal" is input.

Fault and warning log

The servo drive can record the latest 10^[1] faults and warnings and values of status parameters upon fault/warning. If a repeated fault or warning is present in the latest 5 records, the repeated fault can be logged more than once after being cleared.

A fault/warning will still be saved in the fault log after reset. To remove the fault/ warning from the fault log, set H02.31 to 1. The following figure shows the details.

ID	故障码	时间戳	转速	电流Ⅵ	电流V	母线电压	输入端子	输出端子
1	136.1	311253.5s	Orpm	0.0A	0.0A	0. OV	0x001F	0x0003
2	101.0	303793.4s	Orpm	0.0A	0.0A	0. OV	0x0000	0x0000
3	101.0	296710.8s	Orpm	0.0A	0.0A	0.0V	0x001F	0x0003
4	740.0	294902.1s	Orpm	0.0A	0.0A	0.0V	0x001F	0x0002
5	740.2	294902.1s	Orpm	0.0A	0.0A	0. OV	0x001F	0x0002
6	601.4	210654.8s	1001rpm	0.0A	-0.1A	309.1V	0x001F	0x0002
7	601.4	204921.0s	50rpm	0.0A	0.0A	310.4V	0x001F	0x0002
8	601.4	155877.9s	10rpm	0.0A	0.0A	312. TV	0x001F	0x0002
9	120.8	152588.5s	Orpm	0. 0A	0.0A	0. OV	0x001F	0x0003

Read the value of H0b.34 to get the fault/warning code. See examples in the following table.

H0b.34 (hexadecimal)	Description of H0b.34 (hexadecimal)
0101	0: Fault subcode 101: Fault Code

Note

[1]: For -NS models, 20 faults can be recorded.

2 Fault Reset

Faults and warnings of the servo drive are divided into three levels based on severity: No. 1 > No. 2 > No. 3, as shown below.

- No. 1 non-resettable fault
- No. 1 resettable fault
- No. 2 resettable fault
- No. 3 resettable warning

Note

"Resettable" means the keypad stops displaying the fault/warning once a "Reset signal" is input.

Operating procedure:

- To stop the keypad from displaying the fault/warning, set H0d.01 (Fault reset) to 1 or activate the DI terminal assigned with DI function 2 (FunIN.2: ALM- RST, fault and warning reset).
- To reset No. 1 and No. 2 faults, switch off the S-ON signal, and then set H0d.01 to 1 or activate the DI terminal allocated with DI function 2.
- To reset No. 3 warnings, set H0d.01 to 1 or activate the DI terminal allocated with DI function 2.

Note

- Some faults and warnings can be reset only after the fault causes are rectified by modifying the settings. However, a reset operation does not necessarily activate the modifications to settings.
- For modifications activated at next power-on (R, S, T/L1C, L2C powered on again), perform a power cycle.
- For modifications activated after stop, switch off the S-ON signal. The servo drive can operate normally only after modifications are activated.

 $\precsim \mathsf{Related} \text{ function No.}$

Start Process	Fault Symptom	Cause	Check method
FunIN.2	ALM-RST	Fault/Warning reset signal	The servo drive may, depending on the warning types, continue running after warning reset. When FunIN.2 is assigned to a low-speed DI, the effective level change of this DI must be kept for more than 3 ms. Otherwise, fault reset will be inactive. Do not assign FunIN.2 to a high-speed DI. Otherwise, fault/ warning reset will be inactive. • Inactive: Not resetting the fault/warning • Active: Resetting the fault/ warning

3 Description of Warning Codes

• E108.0: Parameter write error Description:

Parameter values cannot be written to EEPROM.

Cause	Troubleshooting	Solution
An error occurs during parameter-writing.	Modify a certain parameter, power off and on the servo drive again and check whether the modification is saved.	If the modification is not saved and the fault persists after the servo drive is powered off and on repeatedly, replace the servo drive.

• E108.1: Parameter read error Description:

Parameter values cannot be read from EEPROM.

Cause	Troubleshooting	Solution
The parameter-read operation is abnormal, and the system indicates an EEPROM read failure.	Modify a certain parameter, power off and on the servo drive again and check whether the modification is saved.	If the modification is not saved and the fault persists after the servo drive is powered off and on repeatedly, replace the servo drive.

• E108.2: EEPROM write check error Description:

The check on the data written in EEPROM failed.

Cause	Troubleshooting	Solution
An error occurs during parameter-writing.	Modify a certain parameter, power off and on the servo drive again and check whether the modification is saved.	If the modification is not saved and the fault persists after the servo drive is powered off and on repeatedly, replace the servo drive.

• E108.3: EEPROM read check error Description:

The check on the data read in EEPROM failed.

Cause	Troubleshooting	Solution
An error occurs during parameter-reading.	Modify a certain parameter, power off and on the servo drive again and check whether the modification is saved.	If the modification is not saved and the fault persists after the servo drive is powered off and on repeatedly, replace the servo drive.

• E108.4: frequent single data reading Description:

During operation, frequent writes of the same parameter or object dictionary by SDO to the EEPROM may result in EEPROM corruption. You can disable this warning by setting bit6 of H0A.71 to 1.

Cause	Troubleshooting	Solution
The same parameter is stored too many times	 Check H0B.90 and H0B.91. H0B.90 shows the parameter in question or object dictionaries (in hexadecimal). If H0B.91= 15, H0B.90 shows internal variables of software. Check "34: Func Test 1" through the oscilloscope channel. Be sure to display it in hexadecimal. The channel displays the address being stored in. Check the storage count through the oscilloscope channel "35: Func Test 2". 	Modify the host controller program after confirming the parameters to be stored to avoid frequent storage of parameters/object dictionaries. You can also modify the value of H0E.01 so that the relevant communication parameters are not saved in the EEPROM. 0: Do not save 1: Save parameter 2: Save object dictionary 3: Save both

• E120.3: The motor and drive do not match in the power Description:

the motor and drive do not match in the rated power.

Cause	Troubleshooting	Solution
The motor and drive do not match in the rated power.	-	 Replace the motor or drive. If the motor and drive can work properly in spite of the mismatch, set bit4 of H0A.71 to 1 to disable the alarm.

• E121.0: Duplicate S-ON command Description:

A redundant S-ON signal is sent when some auxiliary functions are used.

Cause	Troubleshooting	Solution
The external S-ON signal is active when servo drive is enabled internally.	Check whether the following auxiliary functions are used: Check whether DI functions (H0d.02, H0d.03, and H0d.12) are used and whether FunIN.1 (S-ON signal) is active.	Deactivate the DI assigned with FunIN.1 (both hardware DI and virtual DI).

• E122.0: Multi-turn absolute encoder setting error Description:

The motor does not match the absolute position mode or the motor code is set improperly.

Cause	Troubleshooting	Solution
The motor does not match the absolute position mode or the motor code is set incorrectly.	 Check the motor nameplate to see whether the motor is configured with a multi-turn absolute encoder. Check whether H00.00 (motor code) is set properly. 	Reset H00.00 (motor code) according to the motor nameplate or use a suitable motor.

• E600.0: Inertia auto-tuning failure Description:

Vibration cannot be suppressed. You can set notch parameters (H09.12...H09.23) manually to suppress vibration.

The auto-tuned values fluctuate dramatically. Increase the maximum operating speed, reduce the acceleration/deceleration time, and shorten the stroke of the lead screw during ETune operation.

Mechanical couplings of the load are loose or eccentric. Rectify the mechanical faults.

A warning occurs during auto-tuning and causes interruption. Rectify the fault causes and perform inertia auto-tuning again.

The vibration cannot be suppressed if the load carries large inertia. In this case, increase the acceleration/deceleration time to ensure the motor current is unsaturated.

Cause	Troubleshooting	Solution
 Continuous vibration occurs during auto- tuning. The auto-tuned values fluctuate dramatically. Mechanical couplings of the load are loose or eccentric. A warning occurs during auto-tuning and causes interruption. The vibration cannot be suppressed if the load carries a large inertia. In this case, increase the acceleration/deceleration time first to ensure the motor current is unsaturated. 	Perform internal inspection to check whether the torque jitters upon stop (not FFT). Check whether Three times more than the last auto- tuned value for variation less than 5 times; 0.5 times more than last auto-tuned value for variation above 5 times.	 Rectify the fault and perform inertia auto- tuning again. For vibration that cannot be suppressed, enable vibration suppression. Ensure mechanical couplings are connected securely. Increase the maximum operating speed, reduce the acceleration/ deceleration time, and shorten the stroke of the lead screw during ETune operation.

• E601.0: Homing warning Description:

When using the homing function, the home is not found within the time defined by H05.35h.

Cause	Troubleshooting	Solution
1. The home switch is faulty.	There is only high-speed searching but no low-speed searching during homing. After high-speed searching, low-speed searching in the reverse direction applies.	If a hardware DI is used, check whether the corresponding DI function is allocated to a certain DI in group 2003h and check the wiring of this DI. Change the DI logic manually and observe the value of H0B.03 (monitored DI status) to monitor whether the servo drive receives corresponding DI level changes. If the home signal is Z signal but it cannot be found, check the condition of the Z signal.
2. The homing time limit is too short.	Check whether the value of H05.35h (time limit for homing) is too small	Increase the value of H05.35.
3. The speed in high-speed searching for the home switch signal is too low.	Check the distance between the start position of homing and the home switch. Then check whether the setpoint of 6099.01h is too low, resulting in a long homing process.	Increase the value of 6099.01h.

• E601.1: Homing switch error Description:

The homing switch is set improperly.

Cause	Troubleshooting	Solution
The home switch is set improperly.	Check whether the limit signals at both sides are activated. Check whether the limit signal and the deceleration point signal/home signal are both activated. Check whether the positive and negative position limits are activated successively.	Set the position of the physical switch properly.

• E601.2: Homing mode setting error Description:

The homing method value is too large.

Cause	Troubleshooting	Solution
	Check the homing method value (object dictionary 6098h).	Change the value of 6098h.

• E730.0: Encoder battery warning Description:

The voltage of the absolute encoder battery is lower than 3.0 V.

Cause	Troubleshooting	Solution
The voltage of the absolute encoder battery is lower than 3.0 V.	Measure the battery voltage.	Use a new battery with the matching voltage.

Note

E731.0 and E733.0 can trigger E730.0. See E731.0 and E733.0 for other solutions.

• E900.0: DI emergency braking Description:

The logic of the DI terminal (including the hardware DI and virtual DI) allocated with DI function 34 (FunIN.34) is effective.

Cause	Troubleshooting	Solution
The DI function 34 (EmergencyStop) is triggered.	Check whether the logic of the DI allocated with DI function 34 (FunIN.34: Emergency stop) is valid.	Check the operation mode and clear the active DI braking signal without affecting the safety performance.

• E901.0: invalid stop mode Description:

The NDB model is set to a stop mode related to DB.

Cause	Troubleshooting	Solution
The drive is NDB, but a DB- related stop mode is set, including enable OFF stop, No.1 error stop, No. 2 error stop, and overtravel stop.	Check the settings of H02.05 (605C), H02.06 (605E), H02.07, and H02.08.	Correct the stop mode in those settings.

• E902.0: DI setting invalid Description:

DI function parameters are set to invalid values.

Cause	Troubleshooting	Solution
DI (DI1DI5) function parameters are set to invalid values.	Check whether H03.02, H03.04, H03.06, H03.08, and H03.10 are set to invalid values.	Set DI function parameters to valid values.

• E902.1: DO setting invalid Description:

DO function parameters are set to invalid values.

Cause	Troubleshooting	Solution
parameters are set to invalid	Check whether H04.00, H04.02, and H04.04 are set to invalid values.	Set DO function parameters to valid values.

• E902.2: Invalid setting for torque reach Description:

The DO parameters set for torque reach in the torque control mode are invalid.

Cause	Troubleshooting	Solution
The DO parameters set for torque reach in the torque control mode are invalid.	Check whether the value of H07.22 is lower than or equal to the value of H07.23 (unit: 0.1%).	Set H07.22 to a value higher than that of H07.23.

• E902.3: invalid position comparison target Description:

The target position value set by H19 parameters exceeds 2^{31} -1 after converted by the electronic gear ratio.

Cause	Troubleshooting	Solution
The target position value set by H19 parameters exceeds 2^{31} -1 after converted by the electronic gear ratio.	values set in H19	Rectify those values so that they do not exceed 2 ³¹ -1.

• E908.0: Model identification failure Description:

The first two check bytes of model identification are incorrect, indicating the attempt to read model identification parameter fails.

Cause	Troubleshooting	Solution
1. The model identification check word store in EEPROM is incorrect.	1. Check whether the warning persists after restart.	Set H01-72 to 1 to disable model identification
2. The model parameters are not written in the drive before delivery.	2. Check whether parameters can be saved to EEPROM.	temporarily.

• E909.0: Motor overload warning Description:

The accumulative heat of the motor reaches the warning threshold.

Cause	Troubleshooting	Solution
1. The motor cables and encoder cable are connected improperly or in poor contact.	Check the wiring among the servo drive, servo motor and the encoder according to the correct wiring diagram.	Connect the cables according to the wiring diagram. It is recommended to use the cables provided by Inovance. When customized cables are used, prepare and connect the customized cables according to the wiring instructions.
2. The load is so heavy that the effective torque outputted by the motor keeps exceeding the rated torque.	Confirm the overload characteristics of the servo drive or motor. Check whether the average load rate (H0b.12) keeps exceeding 100.0%.	Use a servo drive of higher capacity and a matching servo motor. Reduce the load and increase the acceleration/ deceleration time.
3. Acceleration/Deceleration is too frequent or the load inertia is too large.	Check the mechanical inertia ratio or perform inertia auto-tuning. View the value of H08.15 (load moment of inertia ratio). Confirm the individual operation cycle when the servo motor operates cyclically.	Increase the acceleration/ deceleration time.
4. Gains are improper or the stiffness level is too high.	Check whether the motor vibrates and generates unusual noise during operation.	Readjust the gain.
5. The servo drive model or motor model is set improperly.	View the model of the motor equipped with a serial-type encoder in H00.05 and the servo drive model in H01.10.	Read the servo drive nameplate and set the Servo servo drive model (H01.10) and motor model properly according to section "Servo Drive Model and Nameplate" in SV660N Series Servo Drive Selection Guide.

Cause	Troubleshooting	Solution
6. The motor is stalled due to mechanical factors, resulting in overload during operation.	Check the running reference and motor speed (H0b.00) through Inovance servo commissioning software or keypad: • References in the position control mode: H0b.13 (Input position reference counter) • References in the speed control mode: H0b.01 (Speed reference) • References in the torque control mode: H0b.02 (Internal torque reference) Check whether the reference value is not 0 or is very large but the motor speed is 0 RPM in the corresponding mode.	Rectify the mechanical- related problem.
7. The servo drive is faulty.	Power off and on the servo drive.	Replace the servo drive.

• E910.0: Control circuit overvoltage Description:

Overvoltage occurred on the control circuit of the drive.

Cause	Troubleshooting	Solution
Overvoltage occurred on the control circuit of the drive.	 Measure whether the input voltage in the control circuit cable is within the following range:220 V servo drive: Value range: 220 V to 240 V Allowable deviation: – 10% to +10% (198 V to 264 V)380 V servo drive: Value range: 380 V–440 VAllowable deviation: – 10% to +10% (342 V to 484 V) Check whether control circuit cables are connected properly and whether the voltage of control circuit cables (L1C, L2C) is within the specified range. 	Re-connect or replace the cables.

• E920.0: Regenerative resistor overload Description:

The accumulative heat of the regenerative resistor exceeds the set value.

Cause	Troubleshooting	Solution
1. The external regenerative resistor is connected improperly or disconnected.	Remove the external regenerative resistor and measure whether its resistance is " ∞ " (infinite). Measure whether the resistance between terminals P \oplus and C is " ∞ " (infinite).	Replace with a new external regenerative resistor. After confirming the resistance measured is the same as the nominal value, connect it between terminals P⊕ and C. Connect the external regenerative resistor between terminals P⊕ and C with a proper cable.
2. The jumper between terminals P⊕ and D is shorted or disconnected when the built-in regenerative resistor is used.	Measure whether the resistance between terminals P⊕ and D is "∞" (infinite).	Ensure terminals P⊕ and D are jumpered.

Cause	Troubleshooting	Solution
3. H02.25 (Regenerative resistor type) is set improperly when an external regenerative resistor is used.	 Check the setpoint of H02.25. Measure the resistance of the external regenerative resistor connected between P⊕ and C. Check whether the resistance measured is too large by comparing it with the value listed in Table "Specifications of the regenerative resistor". Check whether the value of H02.27 is larger than the resistance of the external regenerative resistor connected between terminals P⊕ and C. 	Set H02.25 according to section Wiring and Setting of Regenerative Resistor in SV660N Series Servo Drive Hardware Guide. H02.25 = 1 (external, naturally ventilated) H02.25 = 2 (external, forced- air cooling)
4. The resistance of the external regenerative resistor is too large.		Select a proper regenerative resistor according to section "Specifications of the Regenerative Resistor" in SV660N Series Servo Drive Commissioning Guide.
5. The setpoint of H02.27 (Resistance of external regenerative resistor) is higher than the resistance of the external regenerative resistor used.		Set H02.27 according to the resistance of the external regenerative resistor used.
6. The input voltage of the main circuit is beyond the specified range.	Check whether the input voltage of the main circuit cable on the drive side is within the following range: • 220 V servo drive:Value range: 220 V to 240 VAllowable deviation: – 10% to +10% (198 V to 264 V) • 380 V servo drive:Value range: 380 V-440 VAllowable deviation: – 10% to +10% (342 V to 484 V)	Replace or adjust the power supply according to the specified range.

Cause	Troubleshooting	Solution
7. The load moment of inertia ratio is too large.	Perform moment of inertia auto-tuning according to section "Inertia auto-tuning" in SV660N Series Servo Drive Function Guide or calculate the total mechanical inertia based on mechanical parameters. Check whether the actual load inertia ratio exceeds 30.	 Select an external regenerative resistor with large capacity and set H02.26 to a value consistent with the actual
8. The motor speed is excessively high and deceleration is not done within the set time. The motor is in the continuous deceleration status during cyclic operation.	View the motor speed curve in cycle running and check whether the motor is in deceleration status for a long period.	 power. Select a larger servo drive. Reduce the load if allowed. Increase the acceleration/ deceleration time if allowed. Increase the motor operation cycle if allowed.
9. The capacity of the servo drive or the regenerative resistor is insufficient.	View the motor's single cycle speed curve and calculate whether maximum braking energy can be absorbed completely.	
10. The servo drive is faulty.	-	Replace the servo drive.

• E922.0: Resistance of the external regenerative resistor too small Description:

The value of H02.27 (resistance of external regenerative resistor) is lower than the value of H02.21 (permissible min. resistance of external regenerative resistor).

Cause	Troubleshooting	Solution
When an external regenerative resistor is used (H02.25 = 1 or 2), the resistance of this resistor is lower than the minimum resistance allowed by the servo drive.	Measure whether the resistance of the external regenerative resistor between terminals P⊕ and C is lower than the value of H02.21 (Permissible minimum resistance of regenerative resistor).	 If yes, replace with an external regenerative resistor that matches the servo drive, then set H02.27 according to the resistance of the resistor used. Finally, connect the new resistor between P⊕ and C. If not, set H02.27 to a value consistent with the resistance of the external regenerative resistor used.

• E924.0: Regenerative transistor overtemperature Description: The estimated temperature of the regenerative transistor is higher than H0A.18 (IGBT overtemperature threshold).

Cause	Troubleshooting	Solution
 The junction temperature of the regenerative transistor is too high. The regenerative transistor will be turned off automatically after overload occurs. 	The regenerative transistor temperature exceeds the threshold defined by H0A.49.	Control the working conditions and usage of the regenerative transistor.

• E941.0: Parameter modifications activated at next power-on Description:

The parameters modified are those whose "Effective time" is "Next power-on".

Cause	Troubleshooting	Solution
The parameters modified are those whose "Effective time" is "Next power-on".	Check whether parameters you modified are those whose "Effective Time" is "Next power-on".	Power off and on the servo drive again.

• E942.0: Parameter saved frequently Description:

The number of parameters modified at a time exceeds 200.

Cause	Troubleshooting	Solution
Too many parameters are	Check whether parameters	Check the operation mode.
modified and saved to	are modified through the	For parameters that need
EEPROM (H0C.13 = 1) at a	host controller at a brief	not be saved to EEPROM, set
brief interval.	interval.	H0C.13 to 0.

• E950.0: Forward overtravel warning Description:

The logic of the DI terminal allocated with DI function 14 (FunIN.14: P-OT, positive limit switch) is effective.

Cause	Troubleshooting	Solution
1. The logic of the DI assigned with FunIN.14 (P- OT function 14, positive limit switch) is effective.	 Check whether a certain DI in group H03 is assigned with FunIN.14. Check whether the logic of DI corresponding to the bit of H0b.03 (Monitored DI status) is effective. 	Check the running mode. On the prerequisite of safety, send a reverse command or rotate the motor to deactivate the logic of the DI terminal allocated with DI function 14.
2. The servo position feedback reaches the positive software position limit.	Check whether the position feedback (H0b.17) is close to the value of H0A.41. Check whether the software position limit is set in H0A.40.	Ensure the servo drive references are proper, allowing the load travel range to be within the software position limit.

• E952.0: Reverse overtravel warning Description:

The logic of the DI terminal allocated with DI function 15 (FunIN.15: N-OT, negative limit switch) is effective.

Cause	Troubleshooting	Solution
1. The logic of the DI assigned with FunIN.15 is effective.	 Check whether a certain DI in group H03 is assigned with FunIN.15. Check whether the logic of DI corresponding to the bit of H0b.03 (Monitored DI status) is effective. 	Check the operation mode. On the prerequisite of ensuring safety, send a forward run command or rotate the motor to deactivate the logic of DI assigned with FunIN.15.
2. The servo position feedback reaches the negative software position limit.	Check whether the position feedback (H0b.17) is close to the value of H0A.43. Check whether the software position limit is set in H0A.40.	Ensure the servo drive references are proper, allowing the load travel range to be within the software position limit.

• E980.0: Encoder algorithm error Description:

An encoder algorithm error occurs.

Cause	Troubleshooting	Solution
An internal fault occurs on the encoder.	If the servo drive is powered off and on several times but the warning is still reported, it indicates that the encoder is faulty.	Replace the servo motor.

• EA41.0: Torque fluctuation compensation failure Description:

The torque compensation fails.

Cause	Troubleshooting	Solution
The torque compensation fails.	-	Turn off the torque fluctuation compensation function.

4 Description of Fault Codes

• E101.0: parameter error in H02 and above Description:

The total number of parameters changes, which generally occurs after software update.

Values of parameters in groups H02 and above exceed the limit, which generally occurs after software update.

Cause	Troubleshooting	Solution
	1. Check whether the control circuit (L1C, L2C) is in the process of power-off or instantaneous power failure occurs.	 Restore default settings (H02.31 = 1), and write parameters again. Enlarge the power capacity or replace with a power supply of higher capacity, restore default settings (H02.31 = 1) and write parameters again.
1. The voltage of the control circuit power supply drops instantaneously.	2. Measure whether the input voltage of the control circuit cable on the non-drive side is within the following range: 220 V servo drive: Value range: 220 V to 240 V Allowable deviation: –10% to +10% (198 V to 264 V) 380 V servo drive: Value range: 380 V–440 V Allowable deviation: –10% to +10% (342 V to 484 V)	Increase the power supply capacity or replace with a power supply of higher capacity. Restore system parameters to default settings (H02.31 = 1), and write parameters again.
2. Instantaneous power failure occurs when saving parameters.	Check whether instantaneous power failure occurs when saving parameters.	Power on the system again, restore system parameters to default settings (H02.31 = 1), and write parameters again.
3. The number of write operations within a certain period of time exceeds the limit.	 Check whether instantaneous power failure occurs during parameter storage. Check whether parameters are updated frequently through the host controller. 	 If the servo drive is faulty, replace the servo drive. Change the parameter writing method and write parameters again.

Cause	Troubleshooting	Solution
4. The software is updated.	Check whether parameter values in group H02 and above exceed the upper/ lower limit due to software update.	Reset the servo drive model and servo motor model, and restore system parameters to default settings (H02.31 = 1).
5. The servo drive is faulty.	If the fault persists though parameters are restored to default settings and the servo drive is powered off and on repeatedly, the servo drive is faulty.	Replace the servo drive.

• E101.1: parameter error in group H00/H01 Description:

The total number of parameters changes, which generally occurs after software update.

Values of parameters in groups H00 or H01 exceed the limit, which generally occurs after software update.

Cause	Troubleshooting	Solution
The servo drive detects whether parameter values in groups H00 and H01 exceed the upper/lower limit during initialization upon power- on. If yes, the keypad displays E101.1. Motor parameters in group H00 are read from the encoder. Servo drive parameters in group H01 are mapped based on the servo drive model defined by H01-10.	Check groups H00 and H01 to find the parameter whose value exceeds the limit. Confirm whether this parameter range is abnormal.	Replace the motor or servo drive.

 E101.2: Address error in read/write operation after the number of parameters changes Description:

Address error in read/write operation after the number of parameters changes.

Cause	Troubleshooting	Solution
The total number of parameters changes after software update, leading to address error in read/write operation.	Read H0b.90 and H0b.91 and obtain the abnormal parameter group number.	Rectify the wrong values. Restore default settings.

• E101.9: Parameter attribute initialization check error

Description:

Parameter attribute initialization check error.

Cause	Troubleshooting	Solution
Parameter attribute initialization check error.	Check that H0A.99 = AA5C.	If the problems persists after the servo drive is powered off and on several times, replace the servo drive.

• E102.0: FPGA communication establishment error Description:

The communication between MCU and FPGA cannot be established.

Cause	Troubleshooting	Solution
between MCU and FPGA	The fault persists after the servo drive is powered off and on repeatedly.	Replace the servo drive.

• E102.1: FPGA initialization start error Description:

FPGA failed.

Cause	Troubleshooting	Solution
FPGA cannot start.	The fault persists after the servo drive is powered off and on repeatedly.	Replace the servo drive.

• E102.8: FPGA and MCU version mismatch Description:

FPGA and MCU version mismatch.

Cause	Troubleshooting	Solution
The software versions of MCU and FPGA are inconsistent.	 Check whether the MCU version (H01.00) is 9xx.x (the fourth digit displayed on the keypad is 9); Check whether the FPGA version (H01.01) is 9xx.x (the fourth digit displayed on the keypad is 9). 	Contact Inovance for technical support. Update the FPGA or MCU software.

• E104.1: MCU running timeout (MCU break down) Description:

The access to MCU times out.

Cause	Troubleshooting	Solution
1. FPGA failure	The fault persists after the servo drive is powered off and on repeatedly.	Replace the servo drive.
2. FPGA and HOST communication handshaking error		
3. Access timeout occurs between HOST and the coprocessor		

• E104.2: Current loop operation timeout (FPGA break down) Description:

The MCU torque interrupt scheduling time is abnormal. This fault is reported only during commissioning.

Cause	Troubleshooting	Solution
1.FPGA failure	The fault persists after the	
2. FPGA and MCU communication handshaking error		Replace the servo drive.

• E104.4: MCU command update timeout Description:

Take the moment when interrupt starts as the starting time, if the time when commands are written to MCU is larger than the time when position and speed regulators are started by FPGA, a warning will be reported.

Cause	Troubleshooting	Solution
The system reports that the encoder communication time is set improperly or the command calculation time is too long.	The fault persists after the servo drive is powered off and on repeatedly.	 Hide unnecessary functions. Replace the servo drive.

• E120.0: Unknown encoder model Description:

The servo drive detects the encoder model during initialization upon power-on. If the encoder model does not comply with the requirement, E120.0 occurs.

Cause	Troubleshooting	Solution
1. The product (motor or servo drive) code does not exist.	Read the nameplates of the servo drive and motor to check whether SV660N series servo drive and 23-bit servo motor are used. Meanwhile, check whether H00.00 (motor code) is set to 14101.	If the motor code is unknown, set H00.00 to 14101 when the SV660N series servo drive and 23-bit servo motor are used.
	Check the servo drive code (H01.02) to see whether this servo drive code exists.	If the drive code is absent, set the servo drive model correctly according to the nameplate.
2. The power rating of the motor does not match that of the servo drive.	Check whether the servo drive code (H01.02) matches the serial-type motor code (H00.05).	Replace the unmatched products.

• E120.1: Unknown motor model Description:

The servo drive detects the motor model defined by H00.00 during initialization upon power-on. If the motor model does not exist, E120.1 occurs.

Cause	Troubleshooting	Solution
The motor model defined by H00.00 is abnormal	Check whether the value of H00.00 matches the used motor.	Rectify the value of H00.00.

• E120.2: Unknown drive model Description:

The servo drive detects the servo drive model defined by H01.10 during initialization upon power-on. If the servo drive model does not exist, E120.2 occurs.

Cause	Troubleshooting	Solution
H01.10 is incorrect	Check the value of H01.10.	Disable servo drive model auto detection and set H01.10 to a proper value manually

• E120.5: Motor and drive current mismatch Description:

The rated output of the servo drive is far higher than the rated current of the motor. You must use a servo drive of lower rated output or a motor with higher rated current.

Cause	Troubleshooting	Solution
The internal scale value is abnormal.	Check whether the servo drive model is correct. If the set current sampling coefficient is too large, calculation overflow will occur.	Replace the servo drive.

- E120.6: FPGA and motor model mismatch Description:
 - The motor model is set improperly, causing mismatch and malfunction of the servo drive.
 - The motor model is set properly, but the motor encoder is not supported by the servo drive.

Cause	Troubleshooting	Solution
FPGA software version and H00.00 mismatch	Check whether the FPGA software version (H01.01) supports the motor model set by H00.00.	Update the FPGA software to support the motor model or replace the motor.

• E120.7: Model check error Description:

The servo drive model parameter cannot be identified.

Cause	Troubleshooting	Solution
Model parameter CRC check failed	Check that the model parameter is present.	Write the model parameter again.

• E120.8: Junction temperature parameter check error Description:

The junction temperature parameter is identified incorrectly.

Cause	Troubleshooting	Solution
Junction temperature parameter CRC check failed	Check that the junction temperature parameter is present	Rewrite the junction temperature parameter.

• E122.1: Different DIs assigned with the same function Description:

The same function is assigned to different DIs.

The DI function No. exceeds the maximum number allowed for DI functions.

Cause	Troubleshooting	Solution
1. Multiple DIs are assigned with the same function.	Check whether parameters in groups H03 (H03.02, H03.04H03.20) and H17 (H17.00, H17.02H17.30) are assigned with the same non- zero DI function No.	Assign different DI function numbers to parameters in groups H03 or H17, and then restart the control circuit to activate the assignment, or switch off the S-ON signal and send a "RESET" signal to activate the assignment.
2. The DI function No. exceeds the maximum number allowed for DI functions	Check whether the MCU program is updated.	Restore system parameters to default values (H02.31 = 1) and restart the servo drive.

• E122.2: Different DOs assigned with the same function Description:

The same function is assigned to different DIs.

The DO function No. exceeds the maximum number allowed for DO functions.

Cause	Troubleshooting	Solution
The DO function No. exceeds the maximum number allowed for DO functions	Check the DO function numbers defined by H04.00, H04.02 and H04.04.	Set the correct DO function No.

• E122.3: Upper limit in the rotation mode invalid Description:

The upper limit (reference range) of the mechanical single-turn position exceeds $2^{\rm 31}$ in the absolute position rotation mode.

Cause	Troubleshooting	Solution
The upper limit of the mechanical single-turn position exceeds 2 ³¹ in the absolute position rotation mode.	Check the setting of the mechanical gear ratio, the upper limit of mechanical single-turn position and the electronic gear ratio when the servo drive runs in the absolute rotation mode (H02.01 = 2).	Reset the mechanical gear ratio, the upper limit of mechanical single-turn position and the electronic gear ratio to ensure the upper limit of the mechanical single-turn position (reference range) does not exceed 2 ³¹ .

• E136.0: Encoder ROM motor parameter check error Description:

When reading parameters in the encoder ROM, the servo drive detects that no parameters are saved there or parameter values are inconsistent with the setpoints.

Cause	Troubleshooting	Solution
1. The servo Servo drive model does not match the motor model.	View the servo drive and servo motor nameplates to check whether the SV660N series servo drive and servo motor are used.	Replace the servo drive and motor.
2. A parameter check error occurs or no parameter is saved in the ROM of the serial incremental encoder.	 Check whether the encoder cable provided by Inovance is used. For cable specifications, see "Matching Cables". The cable must be connected securely without scratching, breaking or poor contact. Measure signals PS+, PS-, +5V and GND on both ends of the encoder cable and observe whether signals at both ends are consistent. For signal assignment, see Chapter "Wiring" in SV680P Series Servo Drive Hardware Guide. 	 Use the encoder cable provided by Inovance. Ensure motor terminals are connected securely and servo drive screws are tightened properly. Use a new encoder cable if necessary. Route encoder cables and power cables (R/S/T, U/V/ W) through different routes.
3. The servo drive is faulty.	The fault persists after the servo drive is restarted.	Replace the servo drive.

- E136.1: Encoder ROM motor parameter read error Description:
 - The encoder cable is not connected properly.
 - A communication error occurs on the encoder due to interference.

Cause	Troubleshooting	Solution
1. The encoder cable connections are incorrect or loosened.	Check the encoder cable connection. Check whether ambient vibration is too large, which loosens the encoder cable and even damages the encoder.	 Connect the encoder cables according to the correct wiring diagram. Re-connect encoder cables and ensure encoder terminals are connected securely.
2. The servo drive is faulty.	The fault persists after the servo drive is restarted.	Replace the servo drive.

-38-

• E136.2: torque ripple compensation data check error Description:

When the servo drive reads the torque ripple compensation data, the data is not consistent with the agreed value.

Cause	Troubleshooting	Solution
1. The motor does not support torque ripple compensation	The encoder version number H00.04 satisfies one of the following conditions: • For the 20-bit encoder, H00.04=20xx.x and H00.04 \neq 204x.x • For the 23-bit encoder, H00.04=2311.x and H00.04 <2311.3 • For the 23-bit encoder, H00.04=2312.x and H00.04 <2312.2	Set H06.28 to 0 to turn off torque ripple compensation.
2. No torque ripple compensation data in the motor	 Check H00.04 and ensure that the motor supports torque ripple compensation. Set H06.28 to 1 to turn on torque ripple compensation. It becomes 0 automatically after restart. 	Carry out torque ripple compensation auto-tuning for the motor.

• E140.0: encryption chip check error Description:

Encryption chip check failure

Cause	Troubleshooting	Solution
Encryption software is not flashed	Check whether the error	Ask the manufacturer to flash the encryption software.

• E140.1: MCU key calculation failed Description:

The version of the encryption chip is incorrect.

Cause	Troubleshooting	Solution
Communication failure between MCU and the encryption chip	Check whether the error persists after restart.	Ask the manufacturer to flash the encryption software.

• E140.2: wrong encryption chip version Description:

The MCU failed to establish communication with the encryption chip.

Cause	Troubleshooting	Solution
Encryption software is not flashed	Check whether the error persists after restart.	Ask the manufacturer to flash the encryption software.

• E140.3: Encryption chip damaged Description:

The MCU failed to establish communication with the encryption chip.

Cause	Troubleshooting	Solution
The MCU failed to establish communication with the encryption chip.	Check whether the error persists after restart.	Ask the manufacturer to flash the encryption software.

• E150.0: STO safety state applied Description:

The STO input protection applies (safety state).

Cause	Troubleshooting	Solution
Two 24 V inputs are disconnected simultaneously, triggering the STO function.	1. Check whether the STO function is activated.	There is no need to take any corrective actions. After the STO terminal is back to normal, clear the fault using the fault reset function.
	2. Check whether the STO power supply is normal.	Check whether the 24 V power supply for the STO is stable. Tighten the cables that are loose or disconnected.
	3. The fault persists after preceding causes are rectified.	Replace the servo drive.

• E150.1: STO input state abnormal Description:

The single-channel input of STO is ineffective.

Cause	Troubleshooting	Solution
1. STO input power supply is abnormal.	Check whether the STO power supply is normal.	Check whether the 24 V power supply for the STO is stable. Tighten the cables that are loose or disconnected.
2.STO input resistor is abnormal.	After STO is triggered, only one STO signal is sent to MCU after the 24 V power supply is cut off due to input resistor drift.	Replace the servo drive.
3. STO is ineffective	The fault persists after preceding causes are rectified.	Replace the servo drive.

• E150.2: Buffer 5 V voltage detection error Description:

The MCU monitors the 5 V power supply of the PWM Buffer to detect whether overvoltage or undervoltage occurs. If the voltage is abnormal, E150.2 occurs.

Cause	Troubleshooting	Solution
The 5 V voltage supplied to the STO Buffer is abnormal due to undervoltage or overvoltage.	Check whether the fault can be removed by a restart. If not, the 5V voltage supplied to the Buffer is abnormal.	Replace the servo drive.

• E150.3: STO input circuit hardware diagnosis failure Description:

Short circuit occurs on the optocoupler of the upstream hardware circuit of STO.

Cause	Troubleshooting	Solution
Short circuit occurs on the upstream optocoupler of STO1 or STO2.	The fault persists and the keypad displays E150.3 after restart.	Replace the servo drive.

• E150.4: PWM buffer hardware detection failure Description:

An error occurs on the PWM Buffer integrated circuit during initialization detection upon power-on (the PWM signal cannot be blocked).

Cause	Troubleshooting	Solution
STO Buffer power-on test error	The fault persists and the keypad displays E150.4 after restart.	Replace the servo drive.

• E201.0: Phase-P overcurrent Description:

Cause	Troubleshooting	Solution
1. Gains are set improperly, leading to motor oscillation.	Check whether vibration or sharp noise occurs during start and operation of the motor, or view "Current feedback" in the software tool.	 Motor parameters are set improperly, modify motor parameter values. Current loop parameters are set improperly, modify current loop parameter values. Speed loop parameters are set improperly, leading to motor oscillation. Servo drive operates improperly. Replace it.
2. The encoder cable is aged or corroded, or connected incorrectly or loosely.	Check whether the encoder cable provided by Inovance is used. Check whether the cable is aging, corroded, or connected loosely. Switch off the S-ON signal and rotate the motor shaft manually. Check whether the value of H0b.17h (Electrical angle) changes as motor shaft rotates.	Re-solder, tighten or replace the encoder cable.

An excessively high current flows through the positive pole of the DC-AC circuit.

Cause	Troubleshooting	Solution
3. The servo drive is faulty.	 Switch off the S-ON signal and rotate the motor shaft manually. Check whether the value of H0b.17 (Electrical angle) changes as motor shaft rotates. Disconnect the motor cable and power on the servo drive again, but the fault persists. Check whether resistance of the external regenerative resistor is too small or the regenerative resistor is short-circuited (between terminals P⊕ and C). 	 Replace with a regenerative resistor with matching resistance and perform wiring again. Replace the servo drive.
4. Overcurrent occurs on the regenerative resistor.	Check whether resistance of the external regenerative resistor is too small or the regenerative resistor is short-circuited (between terminals P, C).	Use a regenerative resistor of matching resistance. Perform wiring again.

• E201.1: Phase-U overcurrent Description:

A current higher than the threshold is collected in the phase-U current.

Cause	Troubleshooting	Solution
 Motor cables are in poor contact. Motor cables are grounded. U/V/W cables of the motor are short-circuited. 	 Check whether the servo drive power cables and motor cables on the U, V, and W sides of the servo drive are loose. After confirming the servo drive power cables and motor cables are connected properly, measure whether the insulation resistance between the servo drive U/V/W side and the PE cable is at MΩ level. 	 Tighten the cables that are loose or disconnected. Replace the motor in case of poor insulation.
4. The motor is damaged.	 Disconnect the motor cables and check whether short circuit occurs among U, V, and W phases and whether burrs exist in the wiring. Disconnect the motor cables and measure whether the resistance among U, V, and W phases of motor cables is balanced. 	 Connect the motor cables correctly. Replace the motor if the resistance is unbalanced.

• E201.2: Phase-V overcurrent Description:

A current higher than the threshold is collected in the phase-V current.

Cause	Troubleshooting	Solution
 Motor cables are in poor contact. Motor cables are grounded. U/V/W cables of the motor are short-circuited. 	 Check whether the servo drive power cables and motor cables on the U, V, and W sides of the servo drive are loose. After confirming the servo drive power cables and motor cables are connected properly, measure whether the insulation resistance between the servo drive U/V/W side and the PE cable is at MΩ level. 	 Tighten the cables that are loose or disconnected. Replace the motor in case of poor insulation.
4. The motor is damaged.	 Disconnect the motor cables and check whether short circuit occurs among U, V, and W phases and whether burrs exist in the wiring. Disconnect the motor cables and measure whether the resistance among U, V, and W phases of motor cables is balanced. 	 Connect the motor cables correctly. Replace the motor if the resistance is unbalanced.

• E201.4: Phase-N overcurrent Description:

An excessively high current flows through the negative pole of the DC-AC circuit.

Cause	Troubleshooting	Solution
1. Gains are set improperly, leading to motor oscillation.	Check whether vibration or sharp noise occurs during start and operation of the motor, or view "Current feedback" in the software tool.	Adjust the gains.
2. The encoder cable is aged or corroded, or connected incorrectly or loosely.	Check whether the encoder cable provided by Inovance is used and whether the cable is aging, corroded, or connected loosely.	Re-solder, tighten or replace the encoder cable.

Cause	Troubleshooting	Solution
3. Overcurrent occurs on the regenerative resistor.	Check whether resistance of the external regenerative resistor is too small or the regenerative resistor is short-circuited (between terminals $P\oplus$ and C).	Replace with a regenerative resistor of matching resistance. Perform wiring again.
4. Overcurrent is caused by the superposition of the braking current and phase current.	Check if the drive accelerates abruptly during braking. Check if the voltage feedback exceeds the release threshold through the Inovance drive commissioning platform, and if the torque command increases abruptly.	Increase the acceleration/ deceleration time.
5. The servo drive is faulty.	Switch off the S-ON signal and rotate the motor shaft manually. Check whether the value of H0b.17 (Electrical angle) changes as motor shaft rotates. Disconnect the motor cable but the fault persists after the servo drive is powered off and on again.	Replace the servo drive.

• E208.2: Encoder communication timeout Description:

Failed to receive the data fed back by the encoder.

Cause	Troubleshooting	Solution
The servo drive fails to receive the data fed back by the encoder in three consecutive cycles.	Check bit12 of H0b.30. Encoder wiring is incorrect. The encoder cable is loosened. The encoder cable is too long. The encoder communication suffers from interference. The encoder is faulty.	 Check whether the motor model is correct. Check the encoder cable. Check whether the encoder version (H00.04) is set properly. The servo drive operates improperly. Replace it.

• E208.3: Current sampling fault Description:

Current sampling is abnormal.

Cause	Troubleshooting	Solution
The phase-U and phase-V current sampling is abnormal.	 Check whether ambient devices are generating disturbance and whether multiple disturbance sources such as variable- frequency devices are present inside the cabinet. The internal current sampling integrated circuit is damaged. 	 Check whether the servo drive and motor are grounded and shielded properly. Install magnetic ring on the motor power cables and encoder cable. Replace the servo drive.

• E208.4: FPGA current loop operation timeout Description:

The operating time of the current loop exceeds the interval threshold.

Cause	Troubleshooting	Solution
FPGA operation timeout	Internal fault code H0b.45 = 4208: Current loop operation timeout	Disable some unnecessary functions to reduce the operating load of the current loop.

• E210.0: Output short-circuited to ground Description:

An abnormal motor phase current or bus voltage is detected during power-on self-testing.

- The DC bus voltage exceeds the discharge threshold.
- The U-phase current of SIZE C/D/E is greater than the setpoint.
- Overcurrent occurs on phase-P and phase-N of servo drives in SIZE A and B.

Cause	Troubleshooting	Solution
1. The servo drive power cables (U/V/W) are short- circuited to ground.	Disconnect the motor cables and measure whether the servo drive power cables (U/ V/W) are short-circuited to ground (PE).	Connect the cables again or replace the servo drive power cables.
2. The motor is short- circuited to ground.	After confirming the servo drive power cables and motor cables are connected properly, measure whether the insulation resistance between the servo drive U/ V/W side and the PE cable is at MΩ level.	Replace the motor.

Cause	Troubleshooting	Solution
3. The servo drive is faulty.	Disconnect the power cables from the servo drive, but the fault persists after the servo drive is powered off and on repeatedly.	Replace the servo drive.
4. The motor speed is too high during phase-to-ground detection.	Check whether the motor is in the generating status during power-on.	Reduce the motor speed.
5. The discharge voltage is below bus voltage	Check the value of H01.41 (discharge threshold setpoint) and H0b.26 (bus voltage). Discharge is triggered when the bus voltage exceeds the discharge threshold. E210.0 may be caused during power-up.	 Measure that the actual value of the bus voltage is the same as H0b.26. Check whether H01.41 is set properly. Check if input voltage is correct.

• E234.0: Runaway

Description:

- The torque reference direction is in reverse to the speed feedback direction in the torque control mode.
- The speed feedback direction is in reverse to the speed reference direction in the position or speed control mode.

Cause	Troubleshooting	Solution
1. The phase sequence of the U, V, and W cables is incorrect.	Check whether the servo drive power cables are connected in the correct sequence at both ends.	Connect the U, V, and W cables according to correct phase sequence.
The interference signal causes an error in the initial phase detection of the motor rotor upon power-on.	The U/V/W phase sequence is correct, but E234.0 occurs when the servo drive is enabled.	Power off and on the servo drive again.
3. The encoder model is wrong or the encoder is wired improperly.	View the servo drive and servo motor nameplates to check whether the devices used are Inovance SV660N series servo drive and 23-bit servo motor.	Replace with a mutually- matching servo drive and servo motor. For use of of SV660N series servo drive and 23-bit servo motor, set H00.00 to 14101. Check the motor model, encoder type, and encoder cable connection again.

Cause	Troubleshooting	Solution
4. The encoder cable is aged or corroded, or connected incorrectly or loosely.	 Check whether the encoder cable provided by Inovance is used and whether the cable is aging, corroded, or connected loosely. Switch off the S-ON signal and rotate the motor shaft manually. Check whether the value of H0b.10 (Electrical angle) changes as motor shaft rotates. 	Re-solder, tighten or replace the encoder cable.
5. The gravity load in vertical axis applications is too large.	Check whether the load of the vertical shaft is too large. Adjust brake parameters H02.09H02.12 and check whether the fault is cleared.	Reduce the load of the vertical axis, increase the stiffness level, or hide this fault without affecting the safety performance and normal use.
6. Improper parameter settings lead to excessive vibration.	The stiffness level is set to an excessively high value, leading to excessive vibration.	Set a proper stiffness level to avoid excessive vibration.

• E320.0: Regenerative resistor overload Description:

The regenerative resistor is overloaded.

Cause	Troubleshooting	Solution
The accumulative heat of the regenerative resistor exceeds the maximum thermal capacity of the regenerative resistor.	Check whether the value of H0b.67 exceeds 100%.	 Check if large discharge current is present due to high bus voltage. Ensure that the motor cannot be driven reversely. Replace the servo drive.



In applications where the motor drives a vertical axis or is driven by the load, set H0A.12 to 0 to hide the runaway fault.

• E400.0: Main circuit overvoltage Description:

The DC bus voltage between $P \oplus$ and $N \ominus$ exceeds the overvoltage threshold.

220 V servo drive: Normal value: 310 V Overvoltage threshold: 420 V

380 V servo drive: Normal value: 540 V Undervoltage threshold: 760 V

Cause	Troubleshooting	Solution
1. The voltage input to the main circuit is too high.	Check the power input specifications of the servo drive and measure whether the voltage input to main circuit cables (R/S/T) on the drive side is within the following range: 220 V servo drive: Value range: 220 V to 240 V Allowable deviation: –10% to +10% (198 V to 264 V) 380 V servo drive: Value range: 380 V to 440 V Allowable deviation: –10% to +10% (342 V to 484 V)	Replace or adjust the power supply according to the specified range.
The power supply is unstable or affected by lightning.	Check whether the power supply is unstable, affected by lightning, or complies with the preceding range.	Connect a surge protection device (SPD) and switch on the power supplies of the control circuit and the main circuit. If the fault persists, replace the servo drive.

Cause	Troubleshooting	Solution
3. The regenerative resistor fails.	If the built-in regenerative resistor is used (H02.25 = 0), check whether terminals P ⊕ and D are jumpered. If yes, measure the resistance between terminals C and D. If an external regenerative resistor is used (H02.25 = 1 or 2), measure the resistance of the external regenerative resistor connected between terminals P ⊕ and C. For details, See table "Specifications of the regenerative resistor" in SV660N Series Servo Drive Commissioning Guide.	 If the resistance is "∞" (infinite), the regenerative resistor is disconnected internally. If a built-in regenerative resistor is used, change to use an external regenerative resistor (H02.25 = 1 or 2) and remove the jumper between terminals P ⊕ and D. Select an external regenerative resistor of the same resistance and equal or higher power than the built-in one. If an external regenerative resistor is used, replace with a new one and connect it between P⊕ and C. Set H02.26 (Power of external regenerative resistor) and H02.27 (Resistance of external regenerative resistor) to values consistent with the specifications of the external regenerative resistor used.

Cause	Troubleshooting	Solution
4. The resistance of the external regenerative resistor is too large, resulting in insufficient energy absorption during braking.	Measure the resistance of the external regenerative resistor connected between terminals P⊕ and C, and compare the measured value with the recommended value.	 Replace with a new external regenerative resistor that carries the recommended resistance, and connect it between P⊕ and C. Set H02.26 (Power of external regenerative resistor) and H02.27 (Resistance of external regenerative resistor) to values consistent with the specifications of the external regenerative resistor used.
5. The motor is in abrupt acceleration/deceleration status and the maximum braking energy exceeds the energy absorption value.	Confirm the acceleration/ deceleration time during operation and measure whether the DC bus voltage between P⊕ and N⊖ exceeds the overvoltage threshold during deceleration.	After confirming the input voltage of the main circuit is within the specified range, increase the acceleration/ deceleration time if the operating conditions allow.
6. The bus voltage sampling value deviates greatly from the measured value.	Check whether H0b.26 (Bus voltage) is within the following range: 220 V servo drive: H0b.26 > 420 V 380 V servo drive: H0b.26 > 760 V Measure whether the DC bus voltage detected between terminals $P\oplus$ and $N\ominus$ is lower than the value of H0b.26.	Contact Inovance for technical support.
7. The servo drive is faulty.	The fault persists after the main circuit is powered off and on repeatedly.	Replace the servo drive.

• E410.0: Main circuit undervoltage Description:

The DC bus voltage between $P\oplus$ and $N\ominus$ is lower than the undervoltage threshold.

220 V servo drive: Normal value: 310 V Undervoltage threshold: 200 V (180 V for S5R5 models)

Cause	Troubleshooting	Solution
The power supply of the main circuit is unstable or power failure occurs. Instantaneous power failure occurs.	Check the power input specifications of the servo drive and measure whether the input voltage at the power supply side of the main circuit cables and R/S/ T on the drive side is within the following range: 220 V servo drive: Value range: 220 V to 240 V Allowable deviation: –10% to +10% (198 V to 264 V) Measure the voltages of all the three phases.	Increase the capacity of the power supply.
The power voltage drops during running.	Monitor the power supply voltage and check whether the main circuit power supply is applied to other devices, resulting in insufficient power capacity and voltage drop.	
4. A three-phase servo drive is connected to a single- phase power supply, leading to phase loss.	Check whether the main circuit is wired correctly and whether phase loss detection (H0A.00) is hidden.	Replace the cables and wire the power cables correctly Three-phase: R, S, T
5. The servo drive is faulty.	Check whether H0b.26 (Bus voltage) is within the following range: 220 V servo drive: H0b.26 < 200 V 380 V servo drive: H0b.26 < 380 V The fault persists after the main circuit is powered off and on repeatedly.	Replace the servo drive.

380 V servo drive: Normal value: 540 V Undervoltage threshold: 380 V.

• E410.1: Main circuit de-energized Description:

Phase loss occurs on the three-phase servo drive.

Cause	Troubleshooting	Solution
The power supply is disconnected during operation.	Check the power input specifications of the servo drive and measure whether the input voltage at the power supply side of the main circuit cables and R/S/ T on the drive side is within the following range: 220 V servo drive: Value range: 220 V to 240 V Allowable deviation: -10% to +10% 380 V servo drive: Effective value: 380 to 440 V Allowable deviation: -10% to +10% Measure the voltages of all the three phases. Monitor the power supply voltage and check whether the main circuit power supply is applied to other devices, resulting in insufficient power capacity	Increase the capacity of the power supply.
	and voltage drop. Check whether 200B.1Bh (Bus voltage) is within the following range: 220 V servo drive: H0b.27h < 200 V. 380 V servo drive: H0b.27h < 380 V. The fault persists after the main circuit is powered off and on repeatedly.	Replace the servo drive.
	Check the wiring of the main circuit.	Replace the cables and wire the power cables correctly Three-phase: R, S, T/L1, L2, L3

• E420.0: Main circuit phase loss Description:

Phase loss occurs on the three-phase servo drive.

Cause	Troubleshooting	Solution
1. The three-phase input cables are connected improperly.	Check whether RST cables on the drive side and non- drive side are in good condition and connected properly.	Replace the cables and connect the main circuit cables properly.
2. A single-phase power supply is used for a three- phase servo drive.3. The three-phase power supply is unbalanced or the voltages of the three phases are too low.	Check the specifications of the power supply and measure whether the voltage input to the main circuit is within the following range: 220 V servo drive: Value range: 220 V to 240 V Allowable deviation: –10% to +10% (198 V to 264 V) 380 V servo drive: Effective value: 380 to 440 V Allowable deviation: –10% to +10% (342 V to 484 V) Measure the voltages of all the three phases.	Servo drives of 0.75 kW (H01.10 = 5) can be supplied by single-phase power supplies. If the input voltage complies with the specifications, set H0A.00 (Power input phase loss protection) to 2 (Inhibit phase loss faults and warnings). If input voltage is outside the specified range, replace or adjust the power supply.

• E430.0: Control circuit power supply undervoltage Description:

2. The voltage of the control power supply of servo drives in size C/D/E is below the error threshold.

Cause	Troubleshooting	Solution
1. The control power supply of servo drives in size C/D/E are unstable or fails.	Check the specifications of the power supply and measure whether the voltage input to the main circuit is within the following range: 220 V servo drive: Value range: 220 V to 240 V Allowable deviation: –10% to +10% (198 V to 264 V) 380 V servo drive: Effective value: 380 to 440 V Allowable deviation: –10% to +10% (342 V to 484 V) Measure the voltages of all the three phases.	Increase the capacity of the power supply.
2. The control power supply of servo drives in size C/D/E are in poor contact.	Check whether control circuit cables are connected properly and whether the voltage of control circuit cables (L1C, L2C) is within the specified range.	Re-connect or replace the cables.

• E500.0: motor overspeed Description:

The actual speed of the motor exceeds the overspeed threshold.

Cause	Troubleshooting	Solution
1. The phase sequence of motor cables is wrong.	Check whether the servo drive power cables are connected in the correct sequence at both ends.	Connect the U, V, and W cables according to correct phase sequence.
2. H0A.08 is set improperly.	Check whether the overspeed threshold is lower than the maximum speed. Overspeed threshold = $1.2 \times$ Maximum motor speed (H0A.08 = 0). Overspeed threshold = H0A.08 (when H0A.08 \neq 0, and H0A-08 < $1.2 \times$ maximum motor speed).	Re-set the overspeed threshold according to the mechanical requirements.

Cause	Troubleshooting	Solution
The input reference exceeds the overspeed threshold.	Check whether the motor speed corresponding to the input reference exceeds the overspeed threshold. • Position control mode:In CSP mode, check the gear ratio 6091.01h/6091.02h to determine the position reference increment for an individual synchronization period and convert it to the speed information.In PP mode, check the gear ratio 6091.01h/6091.02h and determine the 6081h (Profile velocity).In HM mode, check the gear ratio 6091.01h/6091.02h, and determine 6099.01h and 6099.02h. • Speed control mode:Check the gear ratio (6091h), target velocity (60FFh), speed limits (H06.06 to H06.09), and the maximum profile velocity (607Fh). • Torque control mode:View the speed limit defined by H07.17 and check the corresponding speed limit.	 Position control mode:CSP: Decrease the position reference increment per synchronization period. The host controller should cover the position ramp when generating references.PP: Decrease the value 6081h or increase the acceleration/ deceleration ramp (6083h, 6084h).HM: Decrease 6099.01h and 6099.02h or increase the acceleration/ deceleration ramp (609Ah). Decrease the gear ratio according to actual conditions. Speed mode:Decrease the target velocity, speed limit, and gear ratio. In PV mode, increase the speed ramp (6083h and 6084h). In CSV mode, the host controller should cover the speed ramp. Torque control mode:Set the speed limit to a value lower than the overspeed threshold.
The motor speed overshoots.	Check whether the speed feedback exceeds the overspeed threshold by using Inovance servo commissioning software.	Adjust the gain or mechanical running conditions.
5. The servo drive is faulty.	The fault persists after the servo drive is powered off and on again.	Replace the servo drive.

• E500.1: Speed feedback overflow Description:

The FPGA speed measurement overflows.

Cause	Troubleshooting	Solution
1. FPGA internal speed overflows.	Check whether the servo drive power cables are connected in the correct sequence at both ends.	Connect the U, V, and W cables according to correct phase sequence.
2. The motor speed overshoots.	Check in the software tool whether the speed feedback exceeds the overspeed threshold.	Adjust the gain or mechanical running conditions.

• E500.2: Velocity feedback error 2 Description:

The MCU has detected that the position feedback increment from the FPGA is too large.

Cause	Troubleshooting	Solution
Communication error occurred between boards of the drive.	The alarm persists in spite of repeated power off and on.	Replace the servo drive.

• E602.0: Angle auto-tuning failure Description:

Unusual jitter occurs on the encoder feedback during angle auto-tuning.

Cause	Troubleshooting	Solution
The data fed back by the encoder is abnormal.	Check if the encoder communication is being disturbed.	Check the wiring of the encoder.

• E602.2: U/V/W phase sequence reversed Description:

A wrong U/V/W phase sequence is detected during angle auto-tuning.

Cause	Troubleshooting	Solution
Incorrect UVW wiring is detected during angle auto- tuning.	Check whether U/V/W phases are wired correctly.	Exchange cables of any two phases among U/V/W and perform auto-tuning again.

• E605.0: Motor speed too high upon S-ON Description:

The motor speed exceeds the rated speed when the servo drive in size A/B is switched on.

Cause	Troubleshooting	Solution
The motor speed exceeds the rated speed when the servo drive is switched on.	Check if the drive is enabled when the motor has been driven.	Switch on the drive when the motor is standstill.

• E620.0: Motor overload Description:

The accumulative heat of the motor reaches the fault threshold.

Cause	Troubleshooting	Solution
1. The motor and encoder cables are connected incorrectly or in poor contact.	Check the wiring between the servo drive, servo motor and the encoder according to the correct "wiring diagram".	Connect the cables according to the wiring diagram. It is recommended to use the cables provided by Inovance. When customized cables are used, prepare and connect the customized cables according to the wiring instructions.
2. The load is so heavy that the effective torque outputted by the motor keeps exceeding the rated torque.	Check the overload characteristics of the servo drive or servo motor. Check whether the average load rate (H0b.12) of the servo drive keeps exceeding 100.0%.	Use a servo drive of higher capacity and a matching servo motor, or reduce the load and increase the acceleration/deceleration time.
3. Acceleration/deceleration is too frequent or the load inertia is too large.	Calculate the mechanical inertia ratio or perform inertia auto-tuning. Check the value of H08.00 (Load inertia ratio). Confirm the individual operation cycle when the servo motor operates cyclically.	Increase the acceleration/ deceleration time during single-cycle running.
4. The gain adjustment is improper or the stiffness is too high.	Check whether the motor vibrates and generates unusual noise during operation.	Readjust the gain.
5. The servo drive model or motor model is set improperly.	Check the motor model (H00.00) and drive model (H01.10) stored in the bus encoder.	Check the servo drive nameplate and set the servo drive model (H01.10) and motor model properly according to section "Servo Drive Model and Nameplate" in SV660N Series Servo Drive Hardware Guide.

Cause	Troubleshooting	Solution
6. The motor is stalled due to mechanical factors, resulting in overload during operation.	Check the reference and motor speed (H0b.00) through the software tool or keypad. • References in the position control mode: H0b.13 (Input position reference counter) • References in the speed control mode: H0b.01 (Speed reference) • References in the torque control mode: H0b.02 (Internal torque reference) Check whether the reference value is not 0 but the motor speed is 0 rpm in the corresponding mode.	Rectify the mechanical- related problem.
7. The servo drive is faulty.	The fault persists after the servo drive is powered off and on again.	Replace the servo drive.

When E620.0 occurs, stop the servo drive for at least 30s before further operations.

• E630.0: motor rotor locked over-temperature Description:

The actual motor speed is lower than 10rpm but the torque reference reaches the limit, and such status lasts for the time defined by H0A.32.

Cause	Troubleshooting	Solution
1. U/V/W output phase loss, wire breakage or incorrect phase sequence occurs on the servo drive.	Perform motor trial run without load and check cable connections and the phase sequence.	Re-connect the cables according to the wiring diagram or replace the cables.
2. The motor parameters (especially the number of pole pairs) are set improperly and motor angle auto-tuning is not performed.	View parameters in group H00 to check whether the number of pole pairs are set properly. Perform angle auto-tuning on the motor several times and check whether the value of H00.28 is consistent during angle auto-tuning.	Modify the motor parameter values.

Cause	Troubleshooting	Solution
3. The communication commands are being disturbed.	Check whether jitter occurs on the commands sent from the host controller and whether EtherCAT communication is being disturbed.	Check whether the communication line between the host controller and the servo drive is being disturbed.
4. The motor is stalled due to mechanical factors.	Check the reference and motor speed (H0b.00) through the software tool or keypad. • References in the position control mode: H0b.13 (Input position reference counter) • References in the speed control mode: H0b.01 (Speed reference) • References in the torque control mode: H0b.02 (Internal torque reference) Check whether the reference value is not 0 but the motor speed is 0 rpm in the corresponding mode. Check the current feedback (torque reference) waveform.	Check whether any mechanical part gets stuck or eccentric.

When E620.0 occurs, stop the servo drive for at least 30s before further operations.

• E640.0: IGBT over-temperature Description:

The IGBT temperature reaches the fault threshold defined by H0A.18.

Cause	Troubleshooting	Solution
 The ambient temperature is too high. The servo drive is restarted repeatedly to reset the overload fault. 	Measure the ambient temperature and view the fault records (set H0b.33 and view H0b.34) to check whether an overload fault/ warning is reported (E620.0, E630.0, E650.0, E909.0, E920.0, E922.0).	 Improve the cooling conditions of the servo drive to lower down the ambient temperature. Change the fault reset method. After overload occurs, wait for 30s before reset. Increase the capacities of the servo drive and servo motor. Increase the acceleration/ deceleration time and reduce the load.
3. The fan is damaged.	Check whether the fan works properly during operation.	Replace the servo drive.
4. The servo drive is installed in a wrong direction and the clearance between servo drives is improper.	Check whether the servo drive is installed properly.	Install the servo drive according to the installation requirements.
5. The servo drive is faulty.	The fault persists even though the servo drive is restarted five minutes after power-off.	Replace the servo drive.

When E620.0 occurs, stop the servo drive for at least 30s before further operations.

• E640.1: Flywheel diode overtemperature Description:

The temperature of the flywheel diode reaches the fault threshold defined by H0A.18.

Cause	Troubleshooting	Solution
 The ambient temperature is too high. The servo drive is restarted repeatedly to reset the overload fault. 	Measure the ambient temperature and view the fault records (set H0b.33 and view H0b.34) to check whether an overload fault/ warning is reported (E620.0, E630.0, E650.0, E909.0, E920.0, E922.0).	 Improve the cooling conditions of the servo drive to lower down the ambient temperature. Change the fault reset method. After overload occurs, wait for 30s before reset. Increase the capacities of the servo drive and servo motor. Increase the acceleration/ deceleration time and reduce the load.
3. The fan is damaged.	Check whether the fan works properly during operation.	Replace the servo drive.
4. The servo drive is installed in a wrong direction and the clearance between servo drives is improper.	Check whether the servo drive is installed properly.	Install the servo drive according to the installation requirements.
5. The servo drive is faulty.	The fault persists even though the servo drive is restarted five minutes after power-off.	Replace the servo drive.

When E620.0 occurs, stop the servo drive for at least 30s before further operations.

• E650.0: Heatsink overtemperature Description:

The temperature of the servo drive power module is higher than the overtemperature threshold.

Cause	Troubleshooting	Solution
1. The ambient temperature is too high.	Measure the ambient temperature.	Improve the cooling conditions of the servo drive to lower down the ambient temperature.
2. The servo drive is restarted repeatedly to reset the overload fault.	View the fault log (set H0b.33 and view H0b.34). Check whether an overload fault or warning (E620.0, E630.0, E650.5, E909.0, E920.0, E922.0) occurs.	Change the fault reset method. After overload occurs, wait for 30s before reset. Increase the capacities of the servo drive and servo motor. Increase the acceleration/ deceleration time and reduce the load.
3. The fan is damaged.	Check whether the fan works properly during operation.	Replace the servo drive.
4. The servo drive is installed in a wrong direction and the clearance between servo drives is improper.	Check whether the servo drive is installed properly.	Install the servo drive according to the installation requirements.
5. The servo drive is faulty.	The fault persists even though the servo drive is restarted five minutes after power-off.	Replace the servo drive.

When E620.0 occurs, stop the servo drive for at least 30s before further operations.

• E660.0: Motor overtemperature Description:

The temperature of the air-cooled motor is too high.

Cause	Troubleshooting	Solution
The temperature of the air- cooled motor is too high.	Measure whether the temperature of the air-cooled motor is too high.	Cool the motor down.

- E661.0: STune failure Description:
 - 1. During STune operation, the gain drops to the lower limit:

Cause	Troubleshooting	Solution
During ETune operation, the gain drops to the lower limit: Position loop gain < 5. Speed loop gain < 5. Model loop gain < 10.	Check if vibration resonance is properly suppressed in the system. The torque vibration amplitude exceeds the setpoint of H09.11.	 Set the notch manually. Modify the electronic gear ratio to improve the command resolution, increase the command filter time constant in the parameter configuration interface. Check whether the machine suffers from periodic fluctuation. Set H09.58 to 1 to clear resonance suppression parameters, and perform STune again.

• E662.0: ETune failure Description:

Check whether resonance that occurred during ETune operation cannot be suppressed.

Cause	Troubleshooting	Solution
Check whether resonance that occurred during ETune operation cannot be suppressed.	Check whether there is abnormal noise or torque fluctuation during operation.	 Set the notch manually when vibration cannot be suppressed automatically. Modify the electronic gear ratio to improve the command resolution, increase the command filter time constant or in the parameter configuration interface. Increase the value of H09.11 as appropriate. Check whether the machine suffers from periodic fluctuation. Check whether the positioning threshold is too low. Increase the reference acceleration/ deceleration time.

• E663.0: ITune failure Description:

Resonance cannot be suppressed.

Cause	Troubleshooting	Solution
Resonance cannot be suppressed.	Check if vibration resonance is properly suppressed in the system. The torque vibration amplitude exceeds the setpoint of H09.11.	 Set the notch manually when vibration cannot be suppressed automatically. Modify the electronic gear ratio to improve the command resolution, increase the command filter time constant or in the parameter configuration interface. Increase the value of H09.11 as appropriate. Check whether the machine suffers from periodic fluctuation.

• E664.0: Resonance too strong Description:

Resonance occurs on the servo system and the torque fluctuation amplitude is higher than the threshold.

Cause	Troubleshooting	Solution
Resonance occurs on the servo system and the torque fluctuation amplitude is higher than the value of H09.54.	Check whether there is abnormal noise or torque fluctuation during operation.	 Check whether the inertia ratio or loop gain parameters are set properly. Check whether resonance parameters are set properly. Increase the value of H09.54 or set H09.54 to 0 to disable this function.

• E731.0: Encoder battery failure Description:

The voltage of the absolute encoder battery is lower than 2.9 V.

Cause	Troubleshooting	Solution
1. The battery is not connected during power-off.	Check whether the battery is connected during power-off.	
2. The encoder battery voltage is too low.	Measure the battery voltage.	Use a new battery with the matching voltage.

• E733.0: Encoder multi-turn counting error Description:

An encoder multi-turn counting error occurs.

Cause	Troubleshooting	Solution
	Set H0d.20 to 2 to clear the fault, but E733.0 persists after restart.	Replace the motor.

• E735.0: Encoder multi-turn counting overflow Description:

A multi-turn counting overflow occurs on the absolute encoder.

Cause	Troubleshooting	Solution
The number of forward revolutions exceeds 32767 or the number of reverse revolutions exceeds 32768.	Check whether the value of H0b.70 (Number of absolute encoder revolutions) is 32767 or 32768 when the servo drive works in the absolute linear mode (H02.01 = 1).	Set H0d.20 to 2 to power on again. Perform homing if necessary.

• E740.0: Absolute encoder communication timeout Description:

Communication timeout occurs on the absolute encoder.

Cause	Troubleshooting	Solution
The communication between the servo drive and the encoder times out.	Check the wiring of the encoder and power on the servo drive again.	 Check whether the encoder version (H00.04) is set properly. Check whether the servo drive software version (H01.00). Check the encoder cable connections. Replace the servo motor.

• E740.2: Absolute encoder error Description:

A communication error occurs on the RX side of the encoder.

Cause	Troubleshooting	Solution
An error occurs on the communication between the servo drive and the encoder.	Check whether the value of H0b.28 is not 0.	 Check whether H00.00 (Motor code) is set properly. Check whether the encoder cable is connected properly. Check whether the servo drive and motor are grounded properly. You can wind a magnetic ring on the encoder cable to reduce interference.

• E740.3: Absolute encoder single-turn calculation error Description:

The encoder is faulty.

Cause	Troubleshooting	Solution
An internal fault occurs on the encoder.	Check whether bit7 of H0b.28 is set to 1.	 Check whether the encoder version (H00.04) is proper. Check whether the encoder cable is proper. Replace the motor.

• E740.6: Encoder data write error Description:

The attempt to write the encoder data fails.

Cause	Troubleshooting	Solution
An error occurs when writing the position offset after angle auto-tuning.	Replace with a new encoder cable. If the fault no longer occurs after cable replacement, it indicates the original encoder cable is damaged. Keep the motor in a certain position, power on the system several times and observe the change of H0b.17 (Electrical angle). The electrical angle deviation should be within $\pm 30^{\circ}$ when the motor position does not change.	Use a new encoder cable. If the fault persists after the encoder cable is replaced, the encoder may be faulty. In this case, replace the servo motor.

• E760.0: Encoder overtemperature Description:

The temperature of the absolute encoder is too high.

Cause	Troubleshooting	Solution
The temperature of the absolute encoder is too high.	Measure the encoder or motor temperature.	Switch off the S-ON signal to wait for the encoder to cool down.

• E765.0: Nikon encoder over-temperature or overspeed Description:

The temperature of the encoder is too high.

Cause	Troubleshooting	Solution
Motor overtemperature	Check if the ambient temperature or the average load rate is too high.	Switch off the S-ON signal to wait for the encoder to cool down.

• E939.0: Motor power cable disconnected Description:

Motor three phase cable breakage.

Cause	Troubleshooting	Solution
Motor three phase cable breakage	Check the wiring of U/V/W power cables.	 Check whether the power cables are disconnected or in poor contact. Re- connect the power cables. Replace the servo motor.

 EA33.0: Encoder read/write check error Description:

Internal parameters of the encoder are abnormal.

Cause	Troubleshooting	Solution
1. The serial incremental encoder cable is disconnected or loose.	Check the wiring.	Check whether the encoder cables are connected incorrectly, disconnected, or in poor contact. If the motor cables and encoder cables are bundled together, separate them.
2. An error occurs when reading/writing the serial incremental encoder parameters.	If the fault persists after the servo drive is powered off and on repeatedly, the encoder is faulty.	Replace the servo motor.

• EB00.0: Position deviation too large Description:

The position deviation in the position control mode is larger than the setpoint of 6065h (Threshold of excessive position deviation).

Cause	Troubleshooting	Solution
1. U/V/W output phase loss or incorrect phase sequence occurs on the servo drive.	Perform a no-load trial run on the motor and check the wiring.	Re-connect the cables according to the wiring diagram or replace the cables.
2. The servo drive U/V/W cables or the encoder cable is disconnected.	Check the wiring.	Reconnect one end of the power cables to the U, V, and W terminals of the servo drive and the other end to those of the servo motor, respectively. If necessary, replace all cables and ensure a reliable connection.
3. The motor is stalled due to mechanical factors.	Check the reference and motor speed (H0b.00) through the software tool or keypad. • References in the position control mode: H0b.13 (Input position reference counter) • References in the speed control mode: H0b.01 (Speed reference) • References in the torque control mode: H0b.02 (Internal torque reference) Check whether the reference value is not 0 but the motor speed is 0 rpm in the corresponding mode.	Rectify the mechanical- related problem.
The servo drive gain is too low.	Check the position loop gain and speed loop gain of the servo drive. 1st gain set: H08.00H08.02 2nd gain set: H08.03H08.05	Adjust the gain values manually or perform gain auto-tuning.

Cause	Troubleshooting	Solution
5. The position reference increment is too large.	Position control mode: • In CSP mode, check the gear ratio 6091.01h/ 6091.02h to determine the position reference increment for an individual synchronization period and convert it to the speed information. • In PP mode, check the gear ratio 6091.01h/6091.02h and determine the 6081h (Profile velocity). • In HM mode, check the gear ratio 6091.01h/ 6091.02h, and determine 6099.01h and 6099.02h.	 CSP: Decrease the position reference increment per synchronization period. The host controller should cover the position ramp when generating references. PP: Decrease the value 6081h or increase the acceleration/deceleration ramp (6083h, 6084h). HM: Decrease 6099.01h and 6099.02h or increase the acceleration/deceleration ramp (609Ah). Decrease the gear ratio according to actual conditions.
6. The value of 6065h is insufficient for the operating conditions.	Check the value of 6065h.	Increase the setpoint of 6065h.
7. The servo drive/motor is faulty.	Monitor the operating waveform using the oscilloscope function of Inovance commissioning software and check whether the operating waveform includes the following information: position reference, position feedback, speed reference, torque reference	If the position reference is not 0 but the position feedback is always 0, replace the servo drive or motor.

• EB00.1: Position deviation overflow Description:

The position deviation is too large.

Cause	Troubleshooting	Solution
1. U/V/W output phase loss or incorrect phase sequence occurs on the servo drive.	Perform a no-load trial run on the motor and check the wiring.	Re-connect the cables according to the wiring diagram or replace the cables.
2. The servo drive U/V/W cables or the encoder cable is disconnected.	Check the wiring.	Reconnect one end of the power cables to the U, V, and W terminals of the servo drive and the other end to those of the servo motor, respectively. If necessary, replace all cables and ensure a reliable connection.
3. The motor is stalled due to mechanical factors.	Check the reference and motor speed (H0b.00) through the software tool or keypad. • References in the position control mode: H0b.13 (Input position reference counter) • References in the speed control mode: H0b.01 (Speed reference) • References in the torque control mode: H0b.02 (Internal torque reference) Check whether the reference value is not 0 but the motor speed is 0 rpm in the corresponding mode.	Rectify the mechanical- related problem.
The servo drive gain is too low.	Check the position loop gain and speed loop gain of the servo drive. • 1st gain set: H08.00 H08.02 • 2nd gain set: H08.03 H08.05	Adjust the gain values manually or perform gain auto-tuning.

Cause	Troubleshooting	Solution
5. The position reference increment is too large.	 Position control mode: In CSP mode, check the gear ratio 6091.01h/ 6091.02h to determine the position reference increment for an individual synchronization period and convert it to the speed information. In PP mode, check the gear ratio 6091.01h/6091.02h and determine the 6081h (Profile velocity). In HM mode, check the gear ratio 6091.01h/ 6091.02h, and determine 6091.01h/ 6091.02h, and determine 6099.01h and 6099.02h. 	 CSP: Decrease the position reference increment per synchronization period. The host controller should cover the position ramp when generating references. PP: Decrease the value 6081h or increase the acceleration/deceleration ramp (6083h, 6084h). HM: Decrease 6099.01h and 6099.02h or increase the acceleration/deceleration ramp (609Ah). Decrease the gear ratio according to actual conditions.
6. The servo drive/motor is faulty.	Monitor the operation waveform through the oscilloscope function in the software tool: position references, position feedback, speed references, and torque references.	If the position reference is not 0 but the position feedback is always 0, replace the servo drive or motor.

• EB01.1: Individual position reference increment too large Description:

The target position increment is too large.

Cause	Troubleshooting	Solution
The target position increment is too large.	Check the variation between two adjacent target positions using the software tool.	 Check whether the maximum speed of the motor fulfills the application requirement. If yes, reduce the target position reference increment, which is to lower the profile reference speed. If not, replace the servo motor. Before switching the mode or enabling the servo drive, check whether the target position is aligned with current position feedback. The communication sequence of the host controller is abnormal, leading to slave data error. Check the communication sequence of the host controller.

• EB01.2: Position reference increment too large continuously Description:

The target position increment is too large.

Cause	Troubleshooting	Solution
The target position increment is too large.	Check the variation between two adjacent target positions using the software tool.	 Check whether the maximum speed of the motor fulfills the application requirement. If yes, reduce the target position reference increment, which is to lower the profile reference speed. If not, replace the servo motor. Before switching the mode or enabling the servo drive, check whether the target position is aligned with current position feedback. The communication sequence of the host controller is abnormal, leading to slave data error. Check the communication sequence of the host controller.

• EB01.3: Command overflow Description:

The target position is still in the process of transmission when the servo limit or software position limit signal is activated and the 32-bit upper/lower limit is reached.

Cause	Troubleshooting	Solution
The target position is still in the process of transmission when the servo limit or software position limit signal is activated and the 32-bit upper/lower limit is reached.	Check whether the host controller continues sending commands after overtravel warning is reported by the servo drive.	 Detect the servo limit signal (bit0 and bit1 of 60FD is recommended) through the host controller. Stop sending limit direction commands when an active servo limit signal is detected by the host controller.

• EB01.4: The target position exceeds the max. value of the single-turn mechanical position in the single-turn absolute mode. Description:

The target position exceeds the upper/lower limit of the single-turn position in the single-turn absolute mode.

Cause	Troubleshooting	Solution
The target position exceeds the upper/lower limit of the single-turn position in the single-turn absolute mode.	Check whether the set target position is within the single- turn upper/lower limit.	Set the target position to a value within the upper/lower limit.

• EB03.0: Electronic gear ratio beyond the limit - H05.02 Description:

The electronic gear ratio exceeds the limit: (0.001–4000 x Encoder resolution/ 10000).

Cause	Troubleshooting	Solution
The electronic gear ratio converted by converted exceeds the maximum gear ratio or is less than the minimum gear ratio.	Check if the electronic gear ratio is within the range of 0.001–4000 × Encoder resolution/10000.	Change the value of H05.02.

• EB03.1: Electronic gear ratio beyond the limit - Electronic gear ratio 1 Description:

The electronic gear ratio exceeds the limit: (0.001–4000 \times Encoder resolution/ 10000).

Cause	Troubleshooting	Solution
The group 1 electronic gear ratio exceeds the maximum gear ratio or is less than the minimum gear ratio.	Check if the group 1 electronic gear ratio is within the range of 0.001–4000 * Encoder resolution/10000.	Change the values of H05.07/H05.09.

• EE08.0: Synchronization (SYNC) signal loss Description:

The SYNC signal is turned off when the EtherCAT network is in the OP state.

Cause	Troubleshooting	Solution
1. The SYNC signal is not generated due to hardware errors.	Check whether the SYNC signal period is 0 using the oscilloscope in the software tool.	Replace the servo drive. Contact Inovance for maintenance.
2) During synchronous communication, the slave performs abnormally in terms of receiving.	 Check whether the STP is used as the communication cable. Check whether the servo drive is well grounded. Check the Ethernet port of the servo drive is damaged. 	 Use the STP. Connect the cable according to the wiring instructions. Check the network connection status through the first LED on the left.
3) During synchronous communication, the master performs abnormally in terms of transmitting.	 The synchronous clock of the host controller is not activated. Excessive error occurs on the synchronization clock of the host controller. 	Measure the synchronization cycle through an actual oscilloscope or the oscilloscope tool in the Inovance servo commissioning software. • If the synchronization cycle is 0, the host controller synchronous clock is not activated. In this case, check whether the network cables connected to each slave come in from the IN port and out from the OUT port. If yes, restart the network. If the network cables are connected in the correct sequence, without the need for prior check, restart the network directly. • If the synchronization period is not 0 and within the permissible fluctuation range (2 us) of the drive, increase the synchronization loss threshold of the slave (H0E.32h).
4. The network switches from OP to non-OP when the servo drive is enabled.	Check whether the network status switches from OP to non-OP.	Check the network status switchover program of the host controller.

• EE08.1: Status switchover error Description:

When the servo drive is enabled, the EtherCAT network status switches from OP to other status.

Cause	Troubleshooting	Solution
1. This fault is caused by mal-operation of the master or the operator.	Check whether the master switches the network status when the servo drive is enabled.	Check the network status switchover program of the host controller.
2) During synchronous communication, the slave performs abnormally in terms of receiving.	 Check whether the STP is used as the communication cable. Check whether the servo drive is well grounded. Check the Ethernet port of the servo drive is damaged. 	 Use the STP. Connect the cable according to the wiring instructions. Check the network connection status through the first LED on the left.
3) During synchronous communication, the master performs abnormally in terms of transmitting.	 The synchronous clock of the host controller is not activated. Excessive error occurs on the synchronization clock of the host controller. 	Measure the synchronization cycle through an actual oscilloscope or the oscilloscope tool in the Inovance servo commissioning software. • If the synchronization cycle is 0, the host controller synchronous clock is not activated. In this case, check whether the network cables connected to each slave come in from the IN port and out from the OUT port. If yes, restart the network. If the network cables are connected in the correct sequence, without the need for prior check, restart the network directly. • If the synchronization period is not 0 and within the permissible fluctuation range (2 us) of the drive, increase the synchronization loss threshold of the slave (H0E.32h).
4. The network switches from OP to non-OP when the servo drive is enabled.	Check whether the network status switches from OP to non-OP.	Check the network status switchover program of the host controller.

• EE08.2: IRQ loss Description:

IRQ signal is lost.

Causa	Troubleshooting	Colution
Cause	Troubleshooting	Solution
1) During synchronous communication, the slave performs abnormally in terms of receiving.	 Check whether the STP is used as the communication cable. Check whether the servo drive is well grounded. Check the Ethernet port of the servo drive is damaged. 	 Use the STP. Connect the cable according to the wiring instructions. Check the network connection status through the first LED on the left.
2) During synchronous communication, the master performs abnormally in terms of transmitting.	 The synchronous clock of the host controller is not activated. Excessive error occurs on the synchronization clock of the host controller. 	Measure the synchronization cycle through an actual oscilloscope or the oscilloscope tool in the Inovance servo commissioning software. • If the synchronization cycle is 0, the host controller synchronous clock is not activated. In this case, check whether the network cables connected to each slave come in from the IN port and out from the OUT port. If yes, restart the network. If the network cables are connected in the correct sequence, without the need for prior check, restart the network directly. • If the synchronization period is not 0 and within the permissible fluctuation range (2 us) of the drive, increase the synchronization loss threshold of the slave (H0E.32h).
3. The network switches	Check whether the network	Check the network status
from OP to non-OP when the servo drive is enabled.	status switches from OP to non-OP.	switchover program of the host controller.

• EE08.3: Network cable connected improperly Description:

The network cable of the servo drive is connected improperly. (The low 16 bits of H0E.29 represents the number of IN port loss events. The high 16 bits of H0E.29 represents the number of OUT port loss events.)

Cause	Troubleshooting	Solution
The physical connection of the data link is unstable or the process data is lost due to plug-in/ plug-out of the network cable.	Check: 1) whether the network cable of the servo drive is connected securely. 2) whether strong vibration occurs on site. 3) whether the network cable is plugged in or out. 4) whether the network cable provided by Inovance is used.	Check the connection of the network port through the change of the H0E.29 value. Use a new network cable that can connect reliably.

• EE08.4 Data frame loss protection error Description:

PDO data is corrupted due to EMC interference or an inferior network cable.

Cause	Troubleshooting	Solution
The data is lost due to EMC interference, poor quality of the network cable or improper connection.	Check whether the high 16 bits of H0E-25 have values that are increased.	 Check whether the servo drive is grounded properly and rectify the EMC problem. Check whether the network cable used is the one designated by Inovance. Check whether the network cable is connected properly.

• EE08.5: data frame transfer error Description:

The upstream slave detects that the data frame has been corrupted and marked, which is then transferred to the downstream slave, leading to a warning event.

Cause	Troubleshooting	Solution
The upstream station detects that the data frame has been corrupted and marked, which is then transfered to the slave, leading to a warning report.	Check whether a processing unit error occurs due to transfer error (H0E.27) or invalid frames (H0E.28) upon occurrence of the fault, and check whether no counting is performed in RX-ERR of Port0.	Check the upstream slave to locate the fault cause.

• EE08.6: Data update timeout Description:

The slave is in the OP status and does not receive the data frame in a long time.

Cause	Troubleshooting	Solution
The data frame is lost or aborted in the upstream slave or the master performance is not up to standard.	Check through the software tool whether the phase difference between SYNC and IRQ exceeds the value of H0E.22 multiplied by the communication period.	 Check whether the operating load of the master CPU is excessive. Increase the communication time or set H0E-22 to a larger value. Check whether link loss occurs on the upstream slave.

• EE09.0: Software position limit setting error Description:

The lower limit of the software limit is equal to or larger than the upper limit.

Cause	Troubleshooting	Solution
The lower limit of the software position limit is equal to or larger than the upper limit.	Check the values of 607D.01h and 607D.02h.	Reset the values and ensure the former is smaller than the latter.

• EE09.1: Home setting error Description:

The home offset exceeds the upper/lower limit.

Cause	Troubleshooting	Solution
1. The home offset is outside the software position limit.	The home offset is outside the software position limit when the encoder works in the incremental mode, absolute linear mode, and single-turn absolute mode.	Set the home offset to a value within the software position limit.
2. The home offset is beyond the upper/lower limit in the rotation mode.	The home offset is outside the mechanical single-turn upper/lower limit when the encoder works in the rotation mode.	Set the home offset to a value within the mechanical single-turn upper/lower limit.

• EE09.2: Gear ratio beyond the limit Description:

The electronic gear ratio exceeds the limit: (0.001, 4000 x Encoder resolution/ 10000).

Cause	Troubleshooting	Solution
The set electronic gear ratio exceeds the preceding range.	The gear ratio 6091.01h/ 6091.02h exceeds the preceding range.	Set the gear ratio within the required range.

• EE09.3: Homing mode setting error

Description:

The MCU does not receive the synchronization signal when the servo communication is switched to OP status.

Cause	Troubleshooting	Solution
1. The communication synchronization clock is configured improperly.	Replace with another master (such as Beckhoff or Omron PLC) and perform tests to compare between different masters.	Rectify improper configurations.
2. The communication IN and OUT ports are connected inversely.	Check the connection of the IN and OUT ports.	Connect the IN and OUT ports in the correct sequence.
3. The slave controller integrated circuit is damaged.	If the fault persists after the master is replaced, measure the synchronization signal generated by the slave controller integrated circuit with an oscilloscope. If there is no signal, the slave controller integrated circuit is damaged.	Contact Inovance for replacing the slave controller integrated circuit.
4.The MCU pins are damaged.	Test the synchronization signal generated by the slave controller integrated circuit with an oscilloscope. If there is a signal, the pins of the MCU integrated circuit are damaged.	Contact Inovance for replacing the MCU chip.

• EE09.5: PDO mapping beyond the limit Description:

The mapping objects in TPDO or RPDO exceeds 40 bytes.

Cause	Troubleshooting	Solution
The mapping objects in TPDO or RPDO exceeds 40 bytes.	In the servo process parameters of the host controller, check the number of self-indexes configured in 1600h or 1A00h.	The mapping objects in TPDO or RPDO must not exceed 40 bytes.

- EE10.0: Protection against MailBox setting error Description:
 - Check if the SM channel is enabled.
 - Check if the read-write direction is configured correctly.
 - Check if it is the Mailbox mode (single-cache mode).

- Check if the length of the received data is between the minimum and maximum set lengths.
- Check if the address of the received data is between the minimum and maximum set addresses.
- Check the read-write mailbox memory for overlap.

Cause	Troubleshooting	Solution
1 The master station is configured incorrectly. 2. The slave XML file is incorrect.	Fault code is displayed on the panel.	Check the configuration of SM0 and SM1 channels for errors.

- EE10.1: SM2 setting error Description:
 - PDO mapping object dictionary index exceeds the set maximum (0x1600– 0x170A).
 - When SM2 is not enabled, the length of SM and the length of RxPDO are not equal to 0.
 - The length of the RxPDO does not match.
 - Not writing.
 - In the preop state, the address of RxPDO is not in the set address field (maximum and minimum addresses), or in a non-preop state, the address of SM2 is equal to the starting address of RxPDO.
 - The memory of SM2 overlaps with adjacent SM1 or SM3.

Cause	Troubleshooting	Solution
 1. The master station is configured incorrectly. 2. The slave XML file is incorrect. 	Check the configuration of SM2 for errors. Check whether the index of the RxPDO mapping object dictionary is out of bounds (the maximum index is 0x0A).	Ensure that the SM2 channel is configured correctly. The index of the RxPDO mapping object dictionary is correct.

- EE10.2: SM3 setting error Description:
 - PDO mapping object dictionary index exceeds the set maximum (0x1A00– 0x1B0A).
 - When SM3 is not enabled, the length of SM and the length of TxPDO are not equal to 0.
 - The length of the TxPDO does not match.
 - Not reading.
 - In the preop state, the address of TxPDO is not in the set address field (maximum and minimum addresses), or in a non-preop state, the address of SM3 is equal to the starting address of TxPDO.
 - Buffer overruns. The memory of SM2 overlaps SM3 and SM0 or SM1).

Cause	Troubleshooting	Solution
 1. The master station is configured incorrectly. 2. The slave XML file is incorrect. 	Check the configuration of SM3 for errors. Check whether the index of the TxPDO mapping object dictionary is out of bounds (the maximum index is 0x1A).	Ensure that the SM3 channel is configured correctly. The index of the TxPDO mapping object dictionary is correct.

- EE10.3: PDO watchdog setting error Description:
 - The watchdog is enabled but the count is 0.
 - The watchdog is not enabled but the count is non-zero.

Cause	Troubleshooting	Solution	
 The watchdog is enabled but the count is 0. The watchdog is not enabled but the count is non-zero. 	The settings of the master station is incorrect.	Make sure the watchdog time is configured correctly.	

• EE10.4: Protection against incomplete PLL (no sync signal) Description:

During SAFEOP-to-OP, DC is enabled, but not running.

Cause	Troubleshooting	Solution	
During SAFEOP_2_OP, DC is enabled, but not running.	The settings of the master station is incorrect.	Make sure a sync0 signal is generated.	

Note

When more than 25 SV660N drives are networked with Omron NX701, you need to modify the cable length defined in the Omron master station. The cable length is calculated based on the fact that one drive needs a length of 36 m.

• EE11.0: ESI check error Description:

The attempt to load the XML file fails during EtherCAT communication.

Cause	Troubleshooting	Solution	
1. The XML configuration file is not downloaded.	Check whether the XML version displayed in H0E.96 is normal.	Download the XML file.	
2. The servo drive is faulty. The XML file is modified unexpectedly.	The XML version number is not empty.	Set H0E. 37 to 1 and power off and on again.	

• EE11.1: EEPROM read failure Description:

The EEPROM communication of external EtherCAT devices fails.

Cause	Troubleshooting	Solution	
The EtherCAT data in the EEPROM cannot be read	This fault persists after the servo drive is powered off and on several times.	Replace the servo drive.	

• EE11.2: EEPROM update failure Description:

The communication is normal but the message in the EEPROM is wrong or lost.

Cause	Troubleshooting	Solution	
The EtherCAT data in the EEPROM cannot be updated.	This fault persists after the servo drive is powered off and on several times.	Replace the servo drive.	

• EE11.3: ESI and drive mismatch Description:

ESI and drive mismatch

Cause	Troubleshooting	Solution
 The downloaded XML file is not compatible with the drive. The servo drive is faulty. The XML file is modified unexpectedly. 	Check whether the XML version displayed in H0E.96 is normal.	Download the XML file.

• EE12.0: EtherCAT initialization failure Description:

During power-on initialization, EtherCAT peripheral initialization failed.

Cause	Troubleshooting	Solution	
The device configuration file is not programmed.	The slave ID is null when the host controller scans the slave.	Program the device configuration file.	
2. The servo drive is faulty.	The servo drive is faulty.	Replace the servo drive.	

• EE13.0: EtherCAT sync period setting error Description:

The synchronization period is not an integer multiple of 125 μs or 250 μs after the network switches to the OP mode.

Cause	Troubleshooting	Solution	
Set the synchronization	Check the setting of the	Set the synchronization	
period to an integer multiple	synchronization period in	period to an integer multiple	
of 125 us or 250 us.	the controller.	of 125 us or 250 us.	

• EE15.0: Excessive EtherCAT sync period error Description:

The synchronization cycle error exceeds the threshold.

Cause	Troubleshooting	Solution	
The synchronization cycle error of the controller is too large.	 Measure the synchronization cycle of the controller. Through a digital oscilloscope. Measure the synchronization cycle of the controller by using the oscilloscope function in the software tool. 	Increase the value of H0E.32.	

Note

You can clear the fault or restart the power supply 30s after overload occurs.

• EE16.0: MCU and ESC communication error Description:

MCU and ESC communication timeout

Cause	Troubleshooting	Solution
communication timeout	The fault persists after the servo drive is powered off and on repeatedly.	Replace the servo drive.

4.1 Internal Faults

When any one of the following fault occurs, contact Inovance for technical support.

- E602.0: Angle auto-tuning failure
- E220.0: Phase sequence incorrect
- EA40.0: Parameter auto-tuning failure

• E111.0: Internal parameter error

5 List of Warning Codes

Fault Code	Fault subcode	Name	Fault level	Resettable	Error code (603Fh)	Aux. Code (203Fh)
	E108.0	Storage parameter write error	No. 3	Yes	0x5530	0x01500150
	E108.1	Storage parameter read error	No. 3	Yes	0x5530	0x11500150
E108	E108.2	Invalid check on data written in EEPROM	No. 3	Yes	0x5530	0x21500150
	E108.3	Invalid check on data read in EEPROM	No. 3	Yes	0x5530	0x31500150
	E108.4	Frequent single data reading	No. 3	Yes	0x0108	0x41500150
E120	E120.3	The motor and drive do not match in the power	No. 3	Yes	0x7122	0x31200120
E121	E121.0	Duplicate S-ON command	No. 3	Yes	0x0121	0x01210121
E122	E122.0	Multi-turn absolute encoder setting error	No. 3	Yes	0x6320	0x01220122
E600	E600.0	Inertia auto-tuning failure	No. 3	Yes	0x0600	0x06000600
	E601.0	Homing warning	No. 3	Yes	0x0601	0x06010601
E601	E601.1	Homing switch error	No. 3	Yes	0x0601	0x16010601
2001	E601.2	Homing mode setting error	No. 3	Yes	0x6320	0x26010601
E730	E730.0	Encoder battery warning	No. 3	Yes	0x7305	0x07300730
E900	E900.0	DI emergency braking	No. 3	Yes	0x0900	0x09000900
E901	E901.0	Invalid stop mode	No. 3	Yes	0x0901	0x09010901
	E902.0	DI setting invalid	No. 3	Yes	0x6320	0x09020902
	E902.1	DO setting invalid	No. 3	Yes	0x0902	0x19020902
E902	E902.2	Torque reach setting invalid	No. 3	Yes	0x0902	0x29020902
	E902.3	Invalid position comparison target	No. 3	Yes	0x0902	0x39020902
E908	E908.0	Model identification check code error	No. 3	Yes	0x0908	0x09080908
E909	E909.0	Motor overload	No. 3	Yes	0x3230	0x09090909
E910	E910.0	Control circuit overvoltage	No. 3	Yes	0x3210	0x09100910
E920	E920.0	Braking resistor overload	No. 3	Yes	0x3210	0x09200920
E922	E922.0	Resistance of the external regenerative resistor too small	No. 3	Yes	0x6320	0x09220922

Table 5–1	Resettable	warning	list
-----------	------------	---------	------

Fault Code	Fault subcode	Name	Fault level	Resettable	Error code (603Fh)	Aux. Code (203Fh)
E924	E924.0	Regenerative transistor over-temperature	No. 3	Yes	0x3230	0x09240924
E941	E941.0	Modified parameters activated at next power- on	No. 3	Yes	0x6320	0x09410941
E942	E942.0	Parameter storage too frequent	No. 3	Yes	0x7600	0x09420942
E950	E950.0	Positive limit switch warning	No. 3	Yes	0x5443	0x09500950
E952	E952.0	Negative limit switch warning	No. 3	Yes	0x5444	0x09520952
E980	E980.0	Encoder algorithm error	No. 3	Yes	0x0980	0x09800980
EA41	EA41.0	Torque fluctuation compensation failure	No. 3	Yes	0x0A41	0x0A410A41

6 List of Fault Codes

No. 1 non-resettable faults:

Fault Code	Fault subcode	Fault Name	Fault level	Resettable	Error code (603Fh)	Aux. Code (203Fh)
	E101.0	Abnormal parameters in groups H02 and above	No. 1	No	0x6320	0x01010101
	E101.1	Parameter error in group H00/H01	No. 1	No	0x6320	0x11010101
E101	E101.2	Address error in read/ write operation after the number of parameters changes	No. 1	No	0x6320	0x21010101
	E101.9	Parameter attribute initialization check error	No. 1	No	0x0101	0x91010101
	E102.0	FPGA communication establishment error	No. 1	No	0x7500	0x01020102
E102	E102.1	FPGA initialization start error	No. 1	No	0x7500	0x11020102
	E102.8	FPGA and MCU version mismatch	No. 1	No	0x7500	0x81020102
	E104.1	MCU running timeout (MCU break down)	No. 1	No	0x7500	0x11040104
E104	E104.2	FPGA running timeout (FPGA break down)	No. 1	No	0x7500	0x21040104
	E104.4	MCU command update timeout	No. 1	No	0x7500	0x41040104
	E120.0	Unknown encoder model	No. 1	No	0x7122	0x01200120
	E120.1	Unknown motor model	No. 1	No	0x7122	0x11200120
	E120.2	Unknown drive model	No. 1	No	0x7122	0x21200120
5100	E120.5	Motor and drive current mismatch	No. 1	No	0x7122	0x51200120
E120	E120.6	FPGA and motor model mismatch	No. 1	No	0x7122	0x61200120
	E120.7	Model check error	No. 1	No	0x0120	0x71200120
	E120.8	Junction temperature parameter check error	No. 1	No	0x0120	0x81200120
	E136.0	Encoder ROM motor parameter check error	No. 1	No	0x7305	0x01360136
E136	E136.1	Encoder ROM motor parameter read error	No. 1	No	0x7305	0x11360136
	E136.2	Torque ripple compensation data check error	No. 1	No	0x7305	0x21360136

Table 6–1 List of No. 1 non-re	settable faults
--------------------------------	-----------------

Fault Code	Fault subcode	Fault Name	Fault level	Resettable	Error code (603Fh)	Aux. Code (203Fh)
	E140.0	Encryption chip check fault	No. 1	No	0x0140	0x01400140
51.10	E140.1	MCU key calculation failed	No. 1	No	0x0140	0x11400140
E140	E140.2	Wrong encryption chip version	No. 1	No	0x0140	0x21400140
	E140.3	Encrypted chip damaged	No. 1	No	0x0140	0x31400140
	E201.0	Phase-P overcurrent	No. 1	No	0x2312	0x02010201
E201	E201.1	Phase-U overcurrent	No. 1	No	0x2312	0x12010201
E201	E201.2	Phase-V overcurrent	No. 1	No	0x2312	0x22010201
	E201.4	Phase-N overcurrent	No. 1	No	0x2312	0x42010201
E210	E210.0	Output short-circuited to ground	No. 1	No	0x2330	0x02100210
E234	E234.0	Runaway	No. 1	No	0x0234	0x02340234
	E740.0	Absolute encoder communication timeout	No. 1	No	0x0740	0x07400740
5740	E740.2	Absolute encoder error	No. 1	No	0x7305	0x27400740
E740	E740.3	Absolute encoder single- turn calculation error	No. 1	No	0x7305	0x37400740
	E740.6	Encoder write error	No. 1	No	0x7305	0x67400740
E765	E765.0	Nikon encoder over- temperature or overspeed	No. 1	No	0x0765	0x07650765
EA33	EA33.0	Encoder read/write check error	No. 1	No	0x7305	0x0A330A33
EE12	EE12.0	EtherCAT initialization failure	No. 1	No	0x0E12	0x0E120E12
EE16	EE16.0	MCU and ESC communication error	No. 1	No	0x0E16	0x0E160E16

No. 1 resettable faults

Fault Code	Fault subcode	Fault Name	Fault level	Resettable	Error code (603Fh)	Aux. Code (203Fh)
	E150.0	STO safety state applied	No. 1	Yes	0x0150	0x01500150
	E150.1	STO input state abnormal	No. 1	Yes	0x0150	0x11500150
	E150.2	Buffer 5 V supply error	No. 1	Yes	0x0150	0x21500150
E150	E150.3	STO input circuit hardware diagnosis failure	No. 1	Yes	0x0150	0x31500150
	E150.4	PWM Buffer hardware diagnosis failure	No. 1	Yes	0x0150	0x41500150
	E208.2	Encoder communication timeout	No. 1	Yes	0x0208	0x22080208
E208	E208.3	Current sampling fault	No. 1	Yes	0x0208	0x32080208
	E208.4	FPGA current loop operation timeout	No. 1	Yes	0x0208	0x42080208
E320	E320.0	Braking resistor overload	No. 1	Yes	0x0320	0x03200320
E400	E400.0	Main circuit overvoltage	No. 1	Yes	0x3210	0x04000400
E410	E410.0	Main circuit undervoltage	No. 1	Yes	0x3220	0x04100410
	E410.1	Main circuit de-energized	No. 1	Yes	0x0410	0x14100410
	E500.0	Motor overspeed	No. 1	Yes	0x8400	0x05000500
E500	E500.1	Speed feedback overflow	No. 1	Yes	0x8400	0x15000500
2300	E500.2	FPGA position feedback pulse overspeed	No. 1	Yes	0x0500	0x25000500
	E602.0	Angle auto-tuning failure	No. 1	Yes	0x0602	0x06020602
E602	E602.2	U/V/W phase sequence reversed	No. 1	Yes	0x0602	0x26020602
E605	E605.0	Speed too fast upon S-ON	No. 1	Yes	0x8400	0x06050605
E620	E620.0	Motor overload	No. 1	Yes	0x3230	0x06200620
E630	E630.0	Motor stall over- temperature protection	No. 1	Yes	0x7121	0x06300630
	E640.0	High IGBT junction overtemperature	No. 1	Yes	0x4210	0x06400640
E640	E640.1	Flywheel diode overtemperature	No. 1	Yes	0x0640	0x16400640
E650	E650.0	Heatsink overtemperature	No. 1	Yes	0x4210	0x06500650
E660	E660.0	Motor overtemperature	No. 1	Yes	0x4210	0x06600660
E939	E939.0	Motor power cables disconnected	No. 1	Yes	0x0939	0x09390939

Table 6–2 List of No. 1 resettable faults

No. 2 resettable faults

Fault Code	Fault subcode	Fault Name	Fault level	Resettable	Error code (603Fh)	Aux. Code (203Fh)
	E122.1	DI function allocation error	No. 2	Yes	0x6320	0x11220122
E122	E122.2	DO function allocation error	No. 2	Yes	0x6320	0x21220122
	E122.3	Upper limit in the rotation mode too high	No. 2	Yes	0x6320	0x31220122
E420	E420.0	Main circuit phase loss	No. 2	Yes	0x3130	0x04200420
E430	E430.0	Control power supply undervoltage	No. 2	Yes	0x3120	0x04300430
E661	E661.0	STune failure	No. 2	Yes	0x0661	0x06610661
E662	E662.0	ETune failure	No. 2	Yes	0x0662	0x06620662
E663	E663.0	ITune failure	No. 2	Yes	0x0663	0x06630663
E664	E664.0	Resonance too strong	No. 2	Yes	0x0664	0x06640664
E731	E731.0	Encoder battery failure	No. 2	Yes	0x7305	0x07310731
E733	E733.0	Encoder multi-turn counting error	No. 2	Yes	0x7305	0x07330733
E735	E735.0	Encoder multi-turn counting overflow	No. 2	Yes	0x7305	0x07350735
E760	E760.0	Encoder over- temperature	No. 2	Yes	0x4210	0x07600760
5000	EB00.0	Excessive position deviation	No. 2	Yes	0x8611	0x0B000B00
EB00	EB00.1	Position deviation overflow	No. 2	Yes	0x8611	0x1B000B00
	EB01.1	Individual position reference increment too large	No. 2	Yes	0x6320	0x1B010B01
	EB01.2	Position reference increment too large continuously	No. 2	Yes	0x6320	0x2B010B01
EB01	EB01.3	Reference overflow	No. 2	Yes	0x6320	0x3B010B01
	EB01.4	The target position exceeds the max. value of the single-turn mechanical position in the single-turn absolute mode.	No. 2	Yes	0x6320	0x4B016B01
	EB03.0	Electronic gear ratio beyond the limit - H05.02	No. 2	Yes	0x0B03	0x0B030B03
EB03	EB03.1	Electronic gear ratio beyond the limit - Electronic gear ratio 1	No. 2	Yes	0x0B03	0x1B030B03

Table 6–3 List of No. 2 resettable faults

Fault Code	Fault subcode	Fault Name	Fault level	Resettable	Error code (603Fh)	Aux. Code (203Fh)
	EE08.0	Synchronization signal loss	No. 2	Yes	0x0E08	0x0E080E08
	EE08.1	Status switchover error	No. 2	Yes	0x0E08	0x1E080E08
	EE08.2	IRQ loss	No. 2	Yes	0x0E08	0x2E080E08
EE08	EE08.3	Network cable connected improperly	No. 2	Yes	0x0E08	0x3E080E08
	EE08.4	Data frame loss protection error	No. 2	Yes	0x0E08	0x4E080E08
	EE08.5	Data frame transfer error	No. 2	Yes	0x0E08	0x5E080E08
	EE08.6	Data update timeout	No. 2	Yes	0x0E08	0x6E080E08
	EE09.0	Software position limit setting error	No. 2	Yes	0x6320	0x0E090E09
	EE09.1	Home setting error	No. 2	Yes	0x6320	0x1E090E09
EE09	EE09.2	Gear ratio beyond the limit	No. 2	Yes	0x6320	0x2E090E09
	EE09.3	Homing method setting error	No. 2	Yes	0x6320	0x3E090E09
	EE09.5	PDO mapping beyond the limit	No. 2	Yes	0x6320	0x5E090E09
	EE10.0	Protection against MailBox setting error	No. 2	Yes	0x0E10	0x0E100E10
	EE10.1	SM2 setting error	No. 2	Yes	0x0E10	0x1E100E10
EE10	EE10.2	SM3 setting error	No. 2	Yes	0x0E10	0x2E100E10
EEIU	EE10.3	PDO watchdog setting error	No. 2	Yes	0x0E10	0x3E100E10
	EE10.4	Protection against incomplete PLL	No. 2	Yes	0x0E10	0x4E100E10
	EE11.0	ESI check error	No. 2	Yes	0x5530	0x0E110E11
EE11	EE11.1	EEPROM bus read failure	No. 2	Yes	0x5530	0x1E110E11
	EE11.2	EEPROM update failure	No. 2	Yes	0x5530	0x2E110E11
	EE11.3	ESI and drive mismatch	No. 2	Yes	0x0E11	0x3E110E11
EE13	EE13.0	EtherCAT sync period setting error	No. 2	Yes	0x6320	0x0E130E13
EE15	EE15.0	Large EtherCAT sync period error	No. 2	Yes	0x0E15	0x0E150E15



Copyright © Shenzhen Inovance Technology Co., Ltd.

19011908B01

Shenzhen Inovance Technology Co., Ltd.

www.inovance.com

Add.: Inovance Headquarters Tower, High-tech Industrial Park, Guanlan Street, Longhua New District, Shenzhen Tel: (0755) 2979 9595 Fax: (0755) 2961 9897

Suzhou Inovance Technology Co., Ltd.

www.inovance.com

 Add.:
 No. 16 Youxiang Road, Yuexi Town, Wuzhong District, Suzhou 215104, P.R. China

 Tel:
 (0512) 6637 6666
 Fax:
 (0512) 6285 6720